



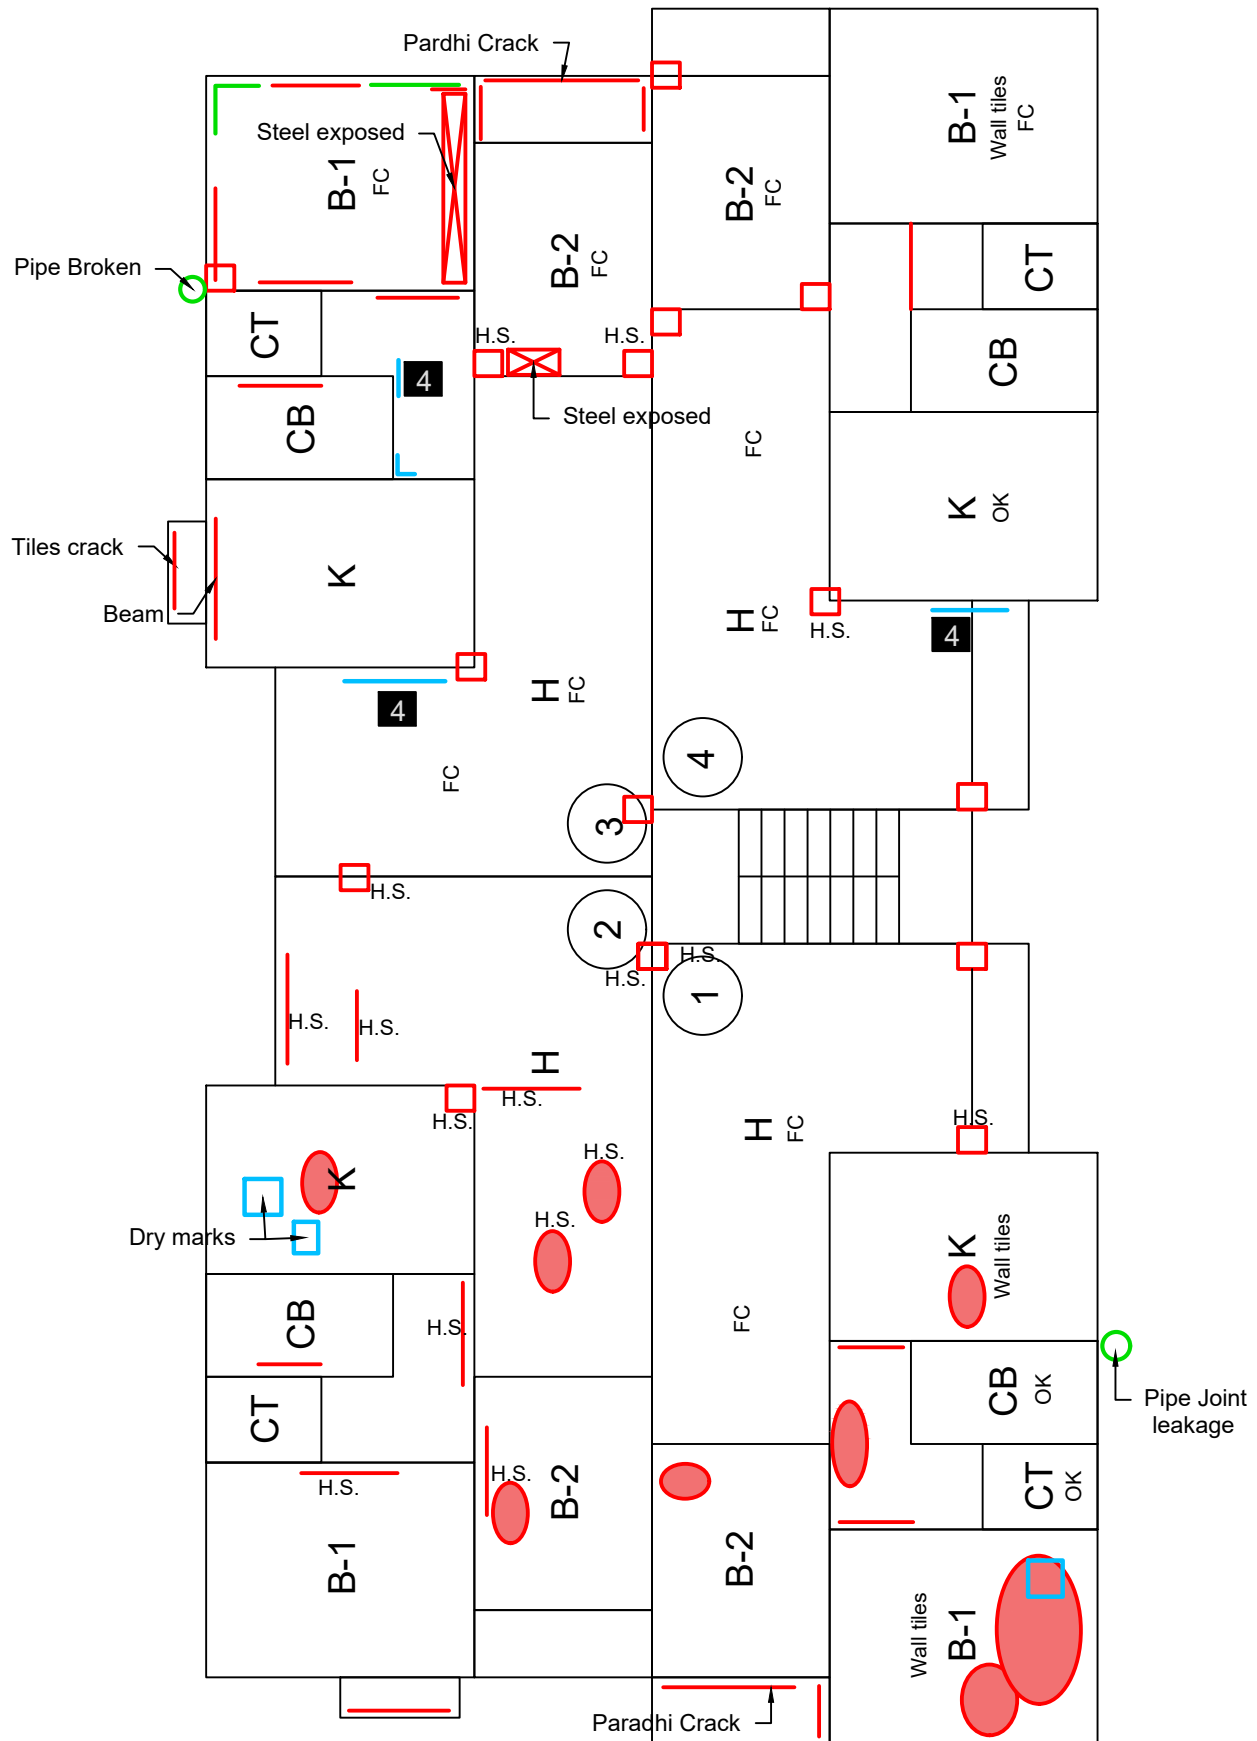


Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	

CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

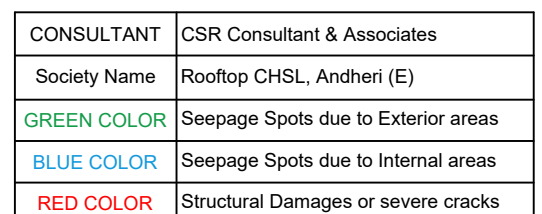


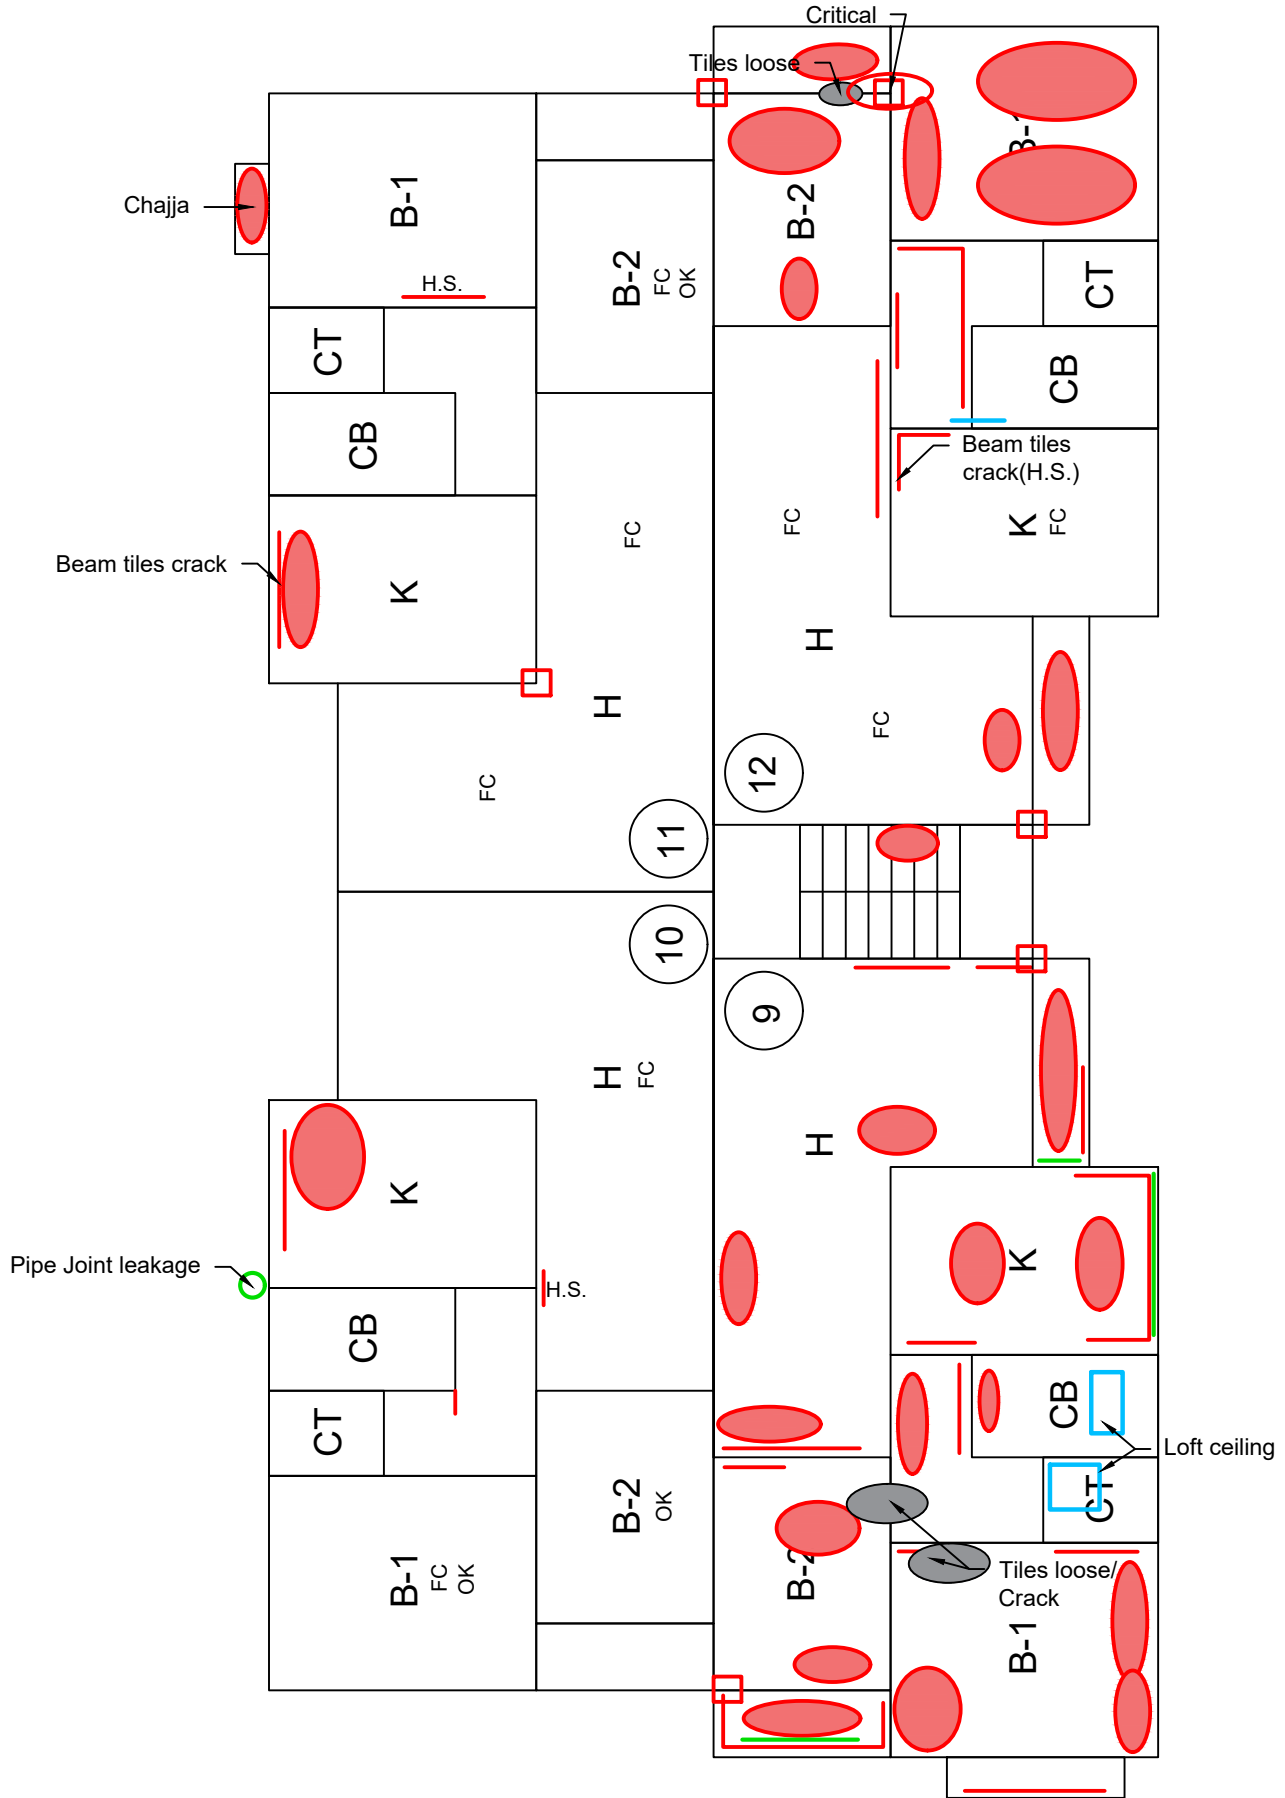

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

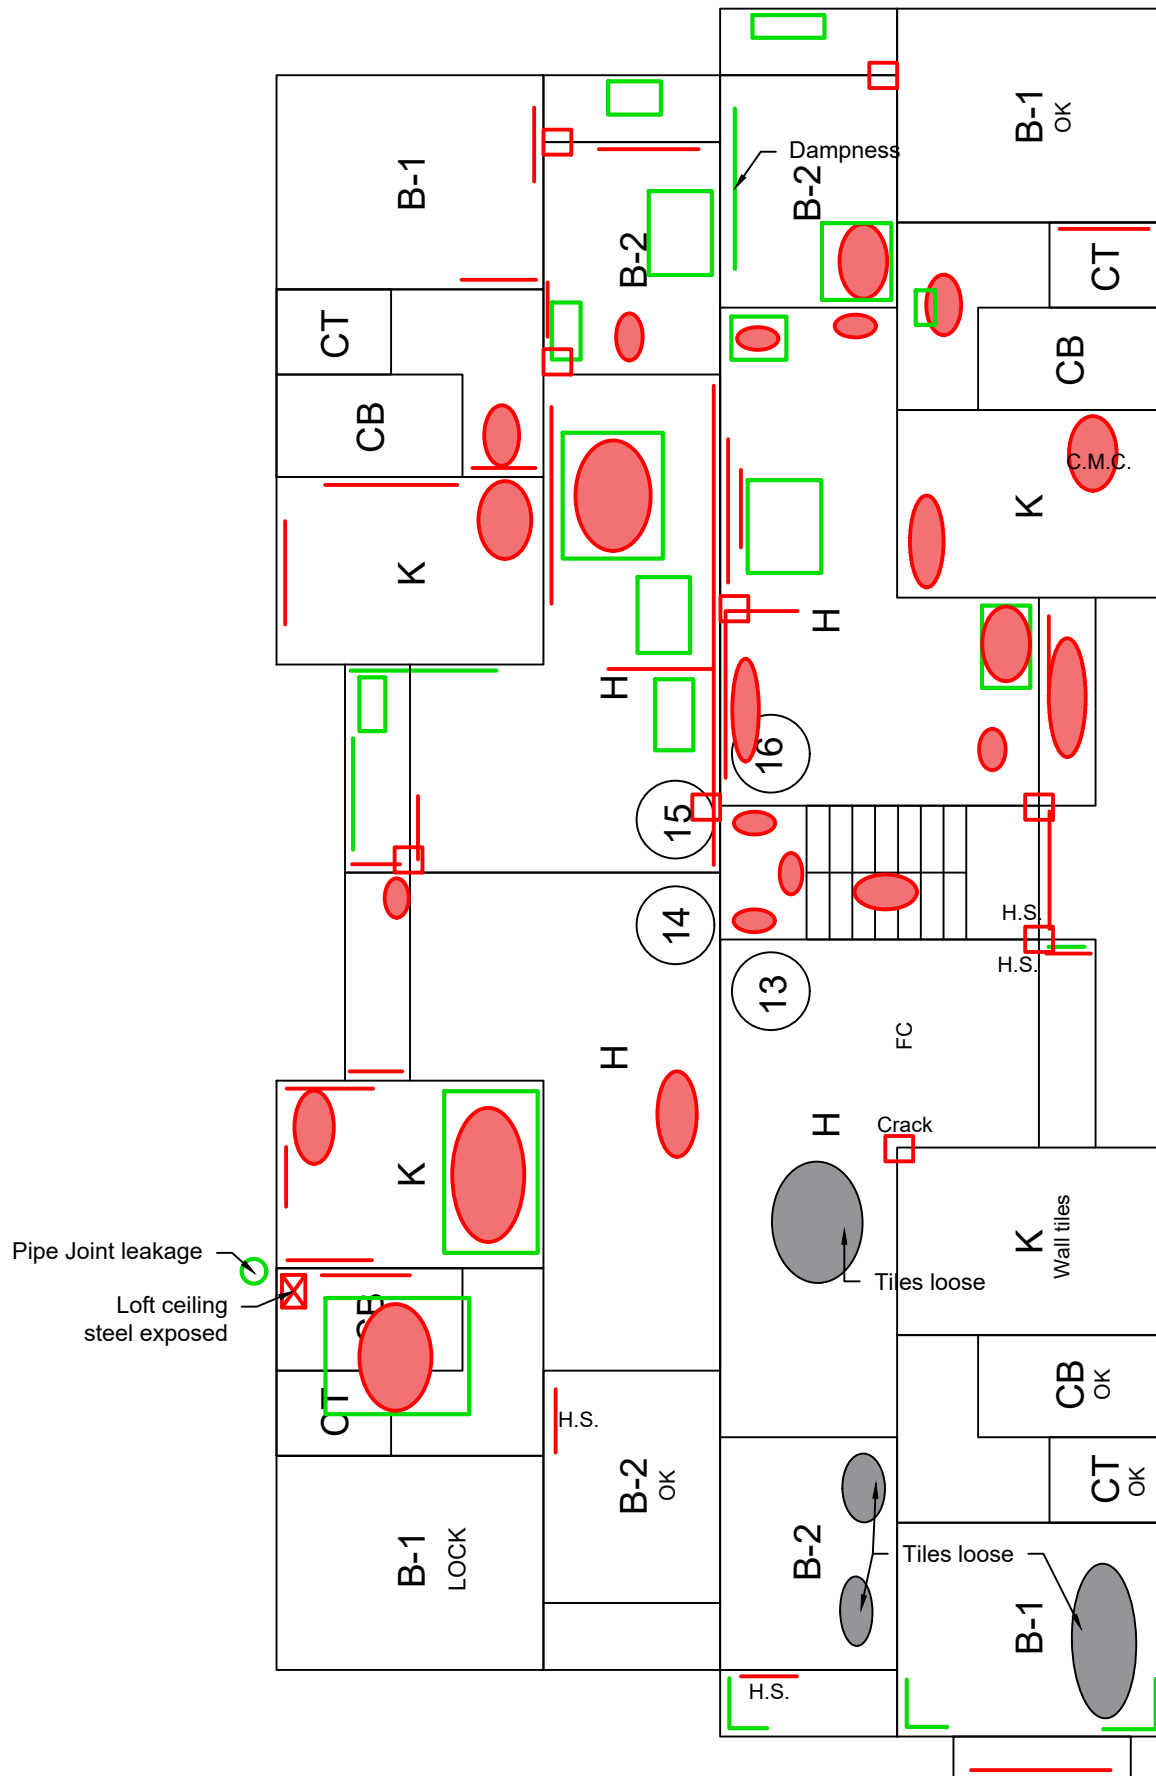

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

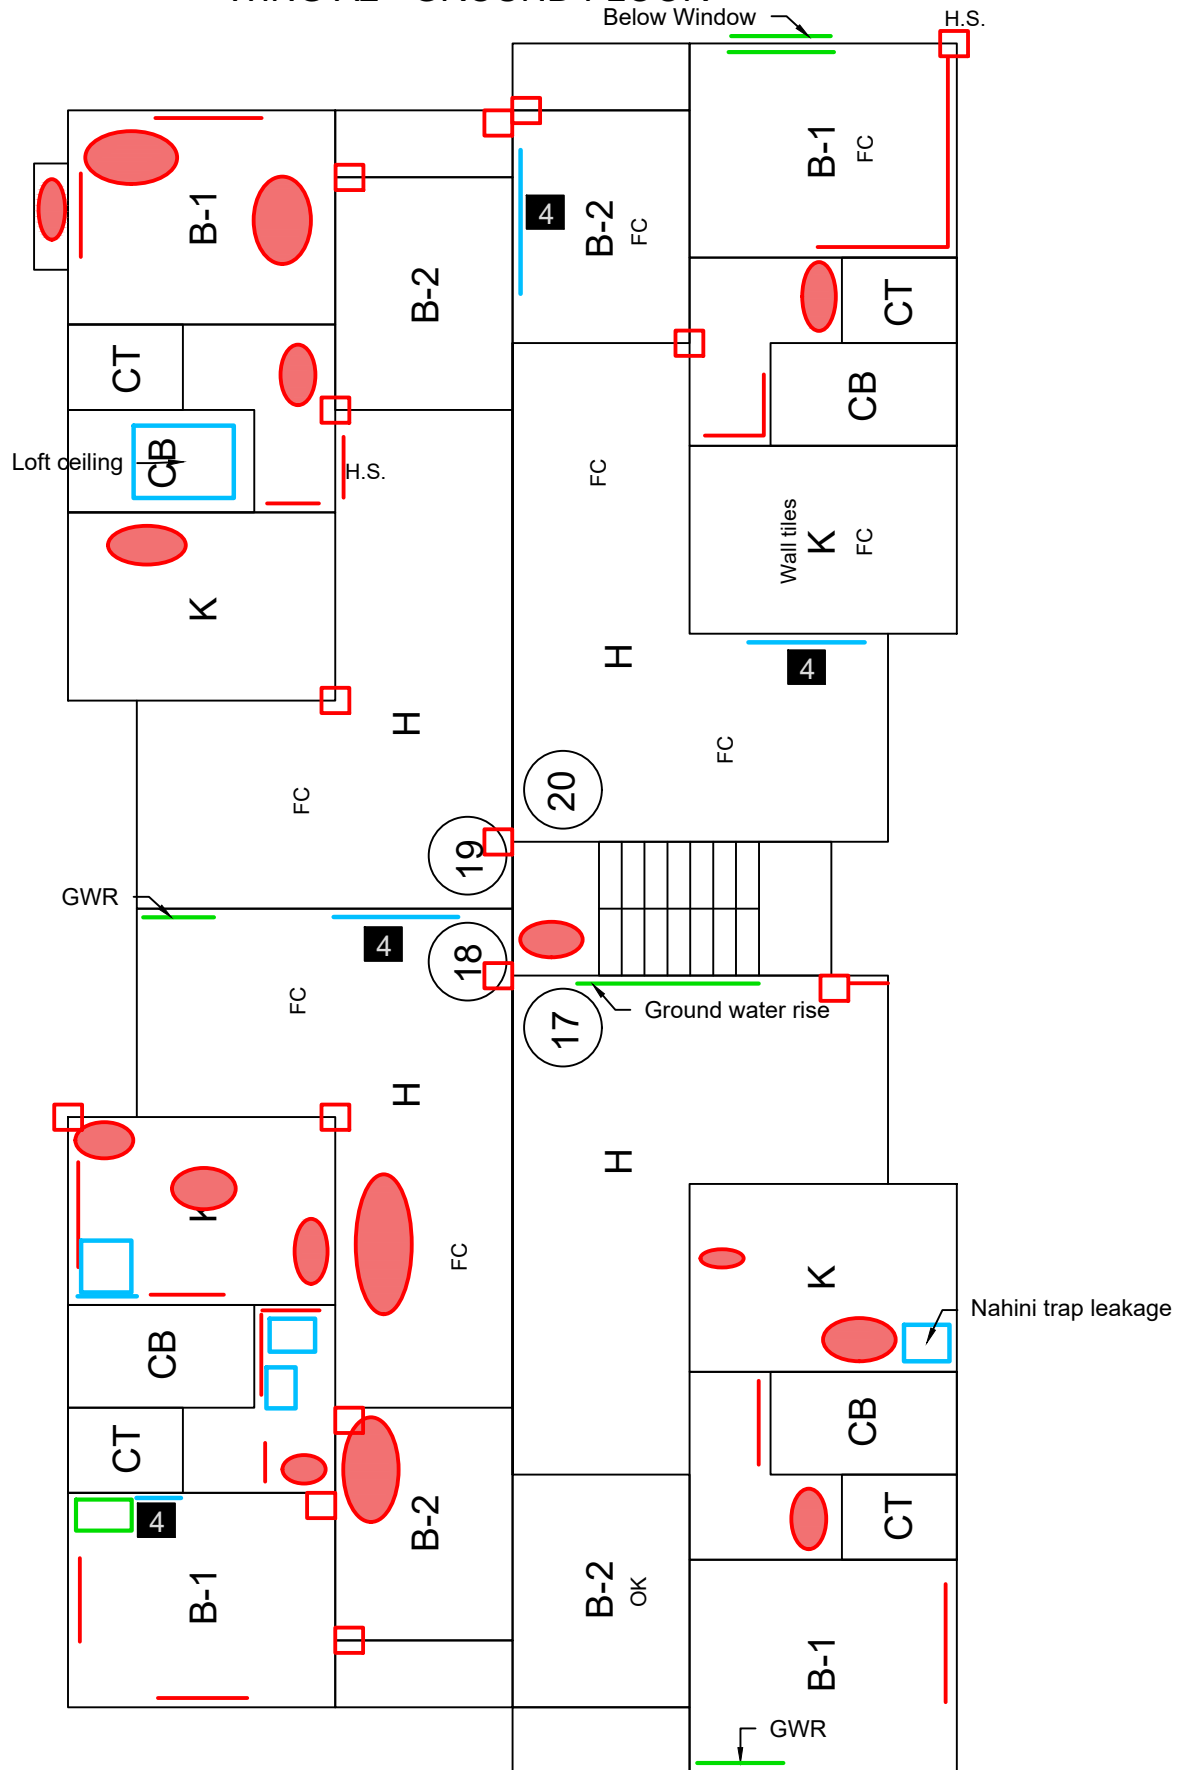

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

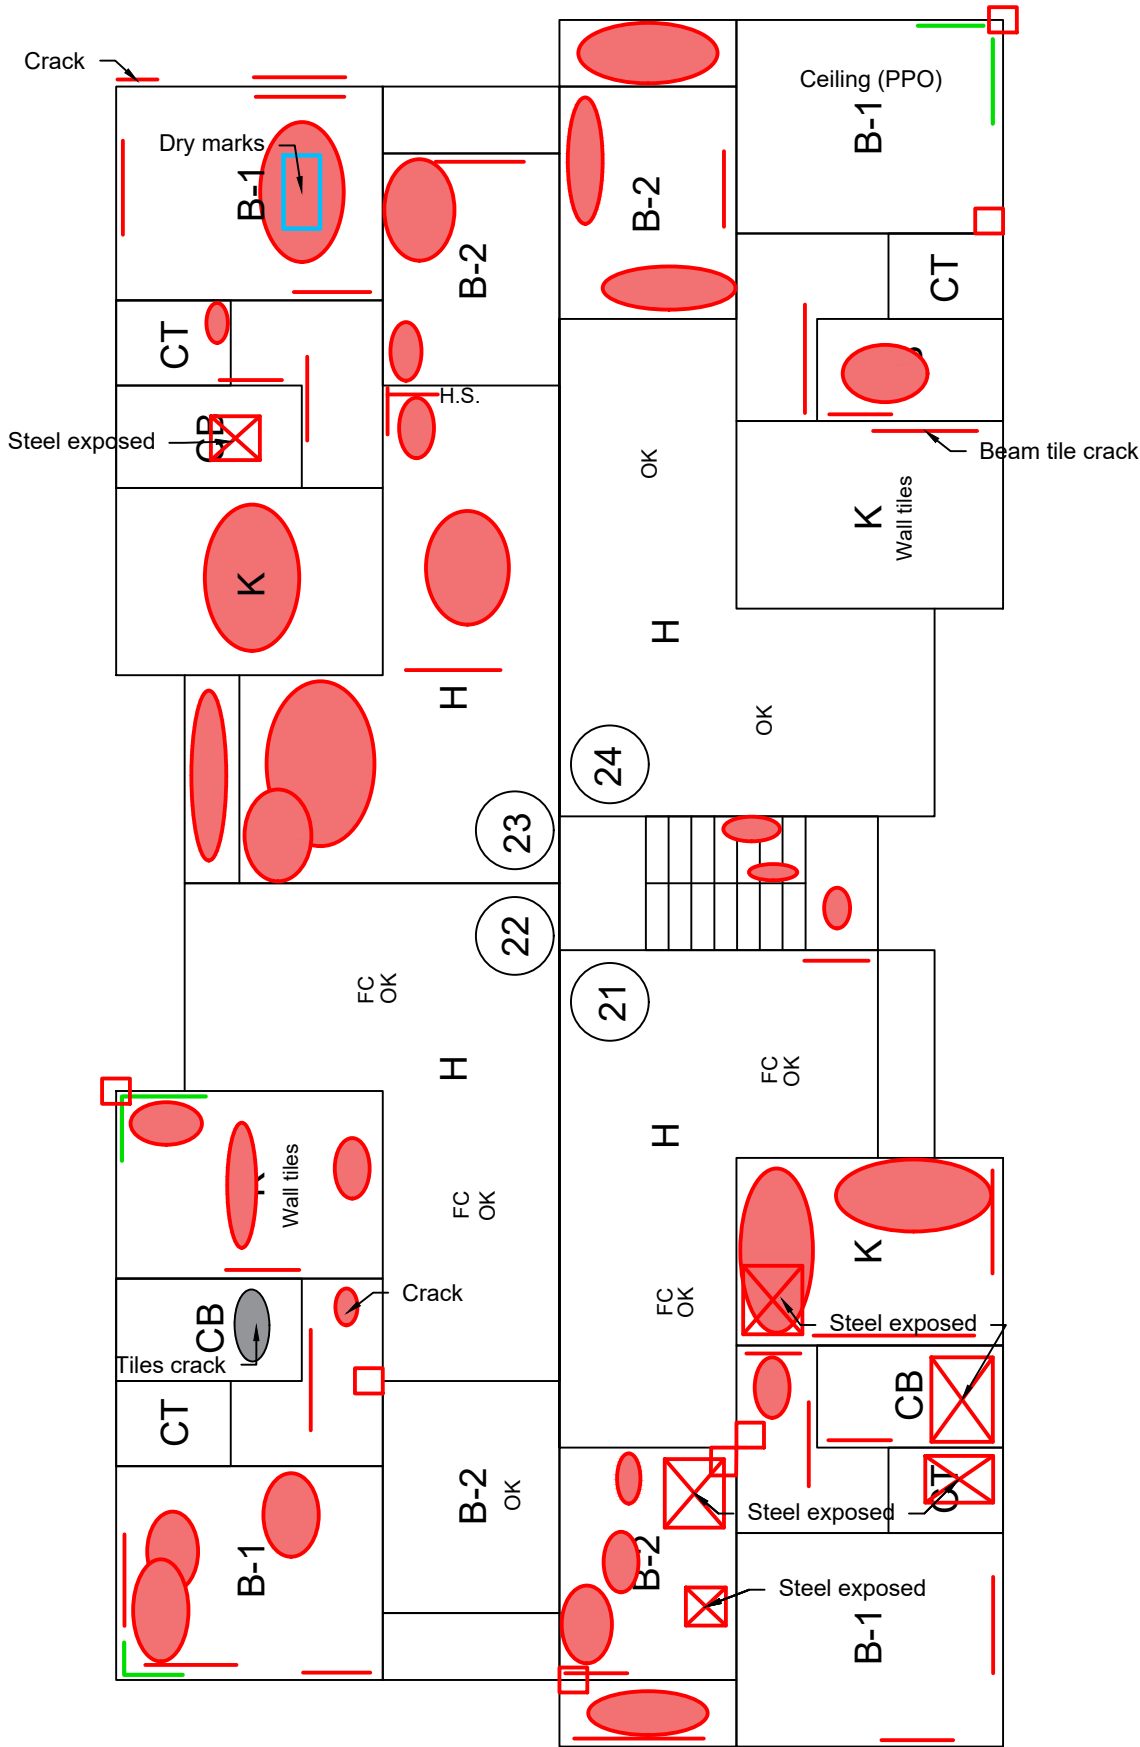

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

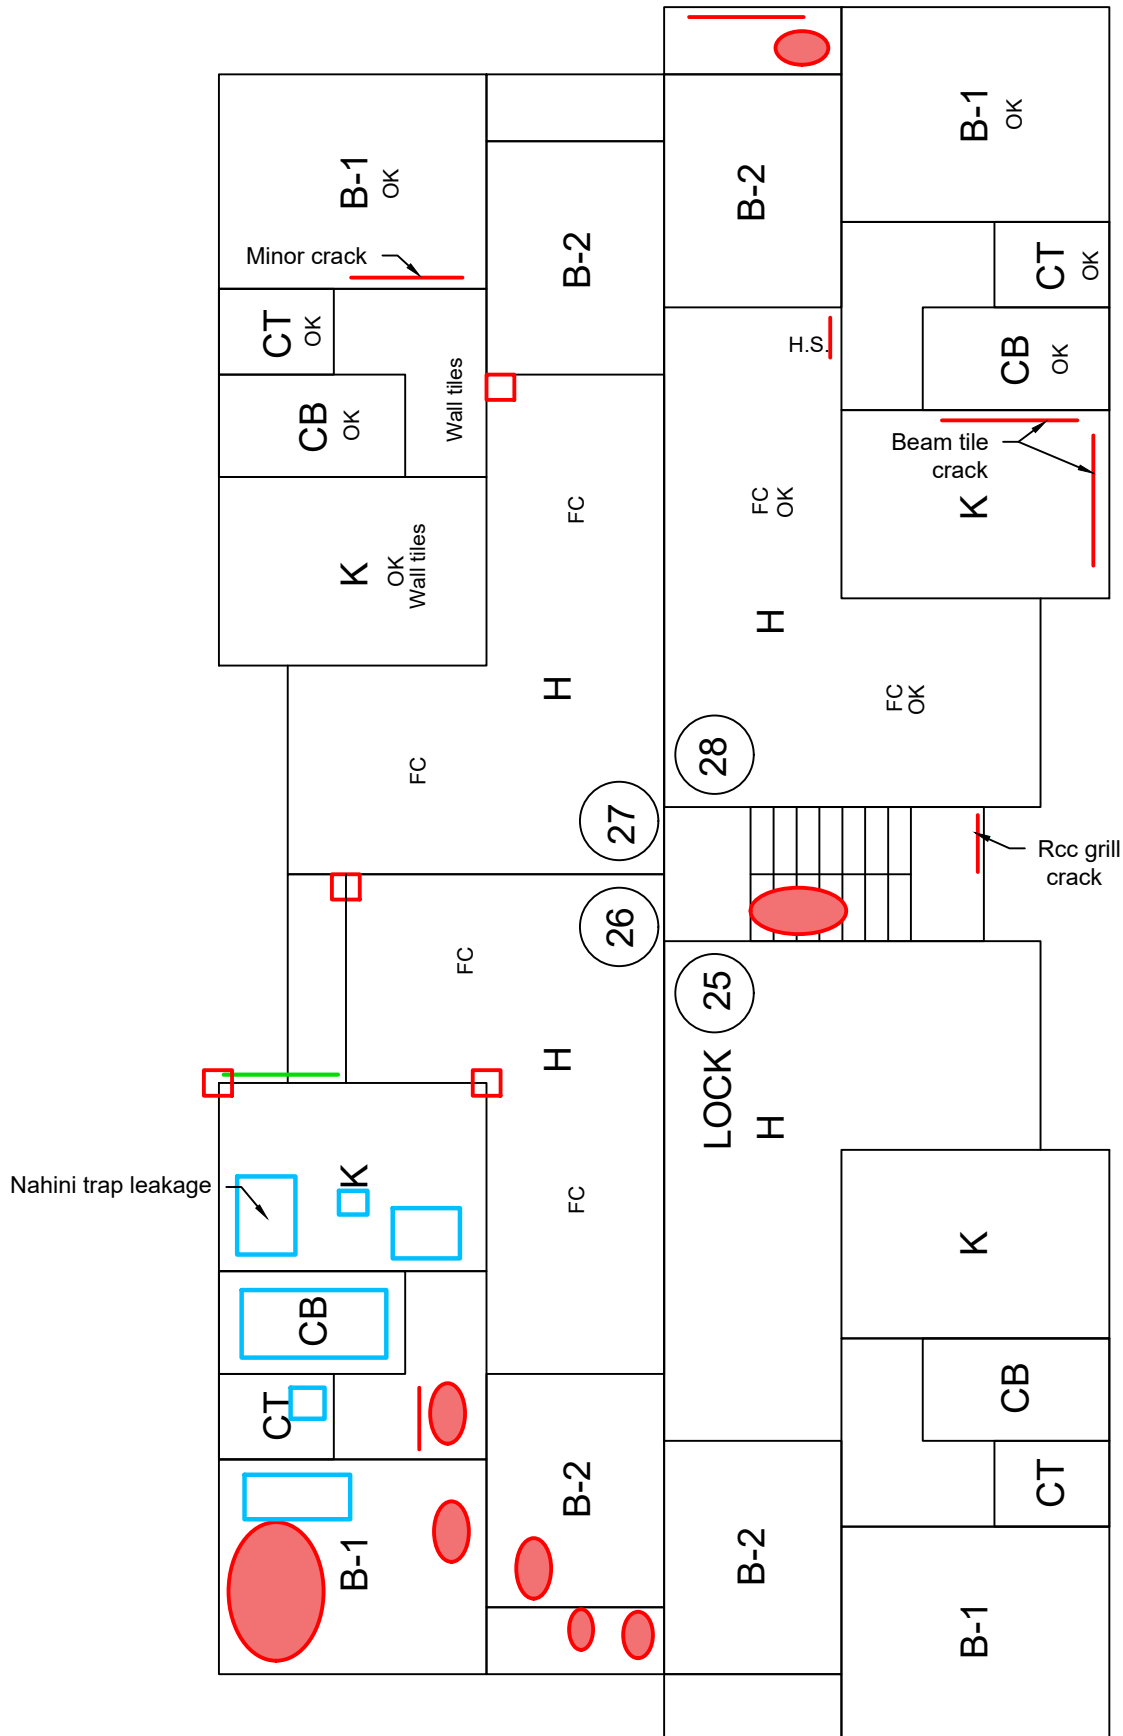


Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	

CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

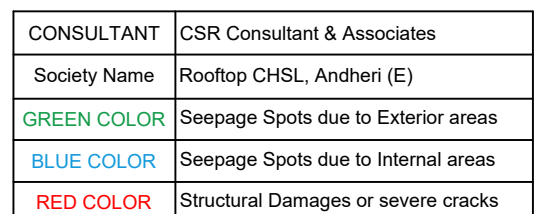


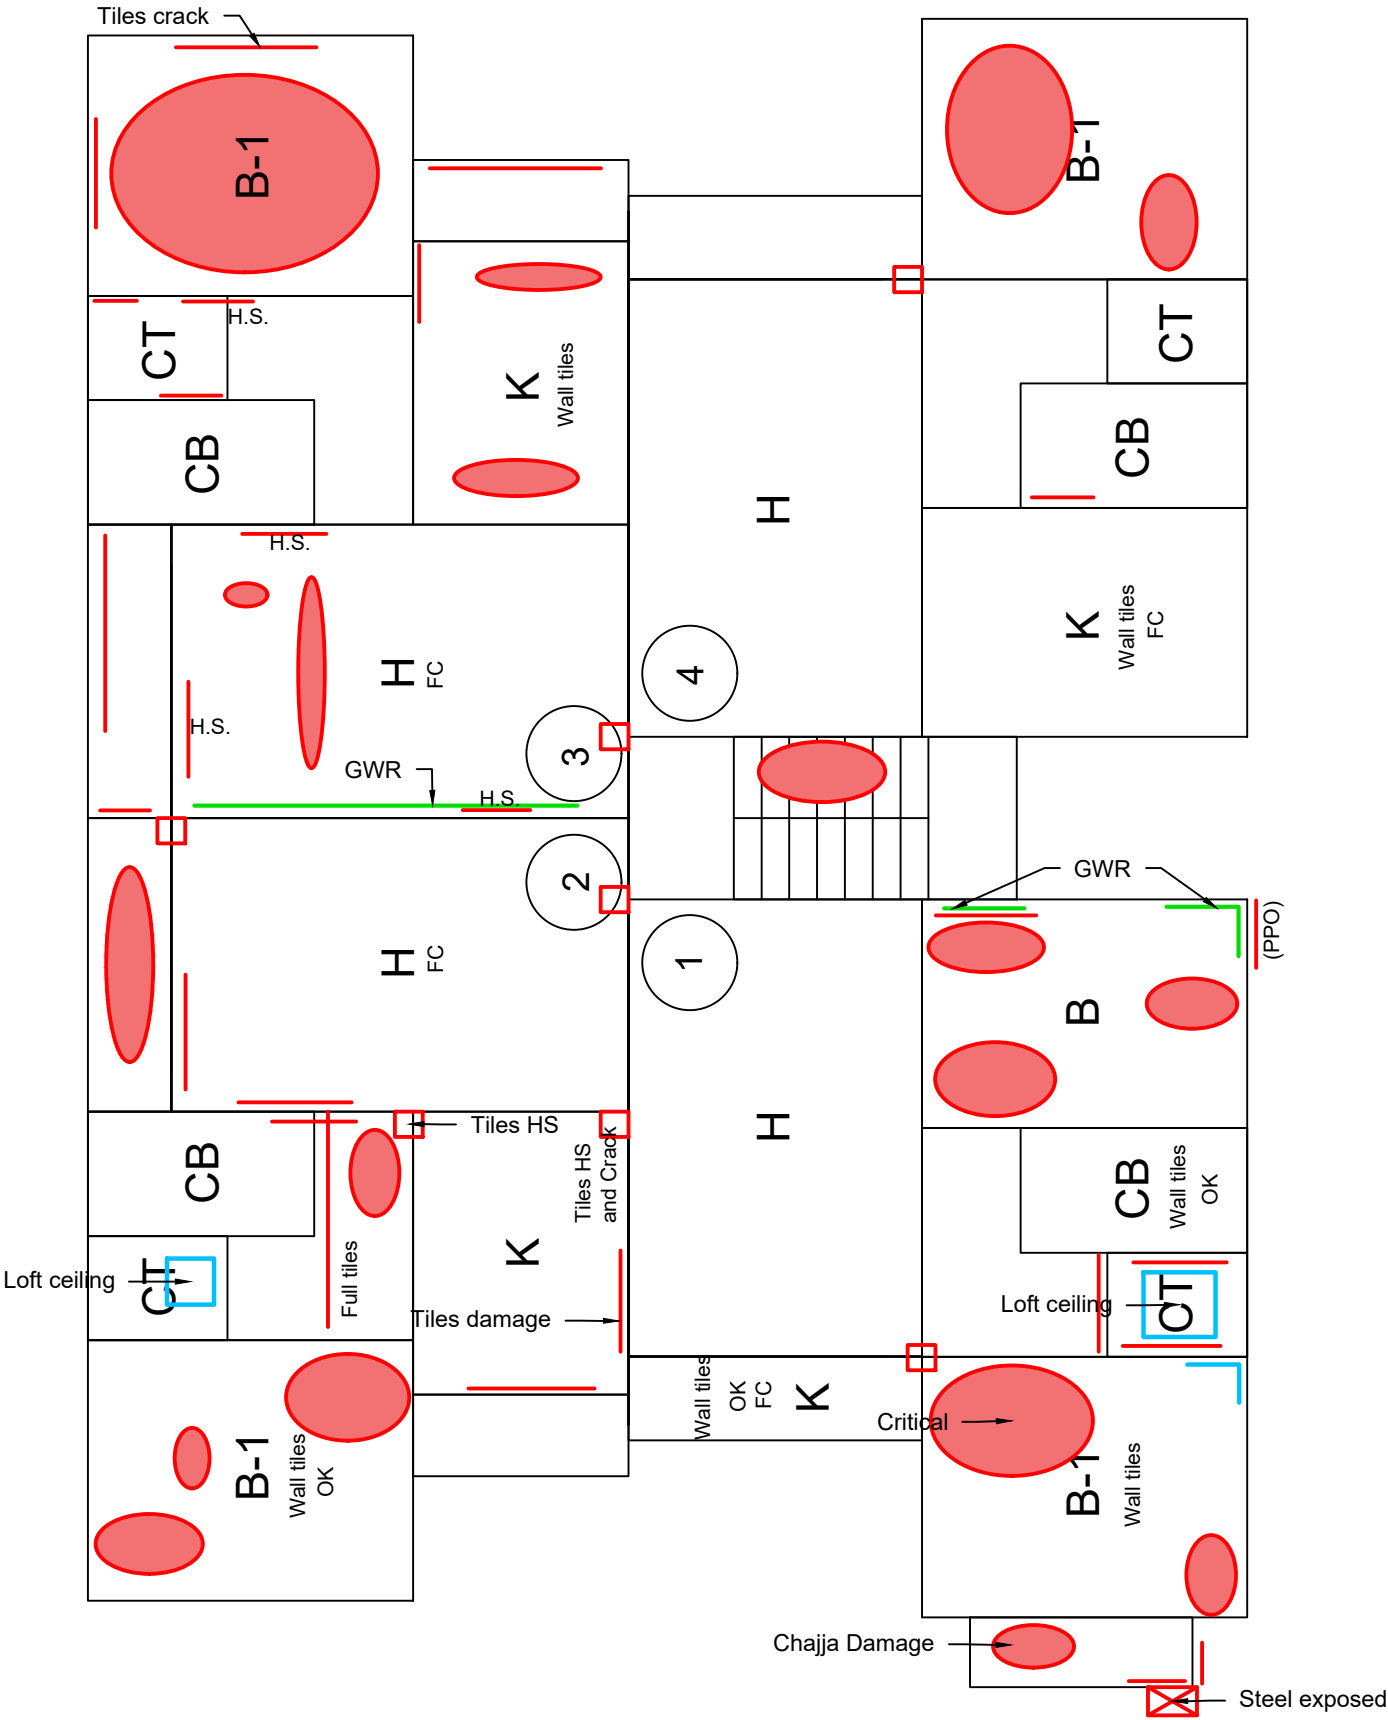

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

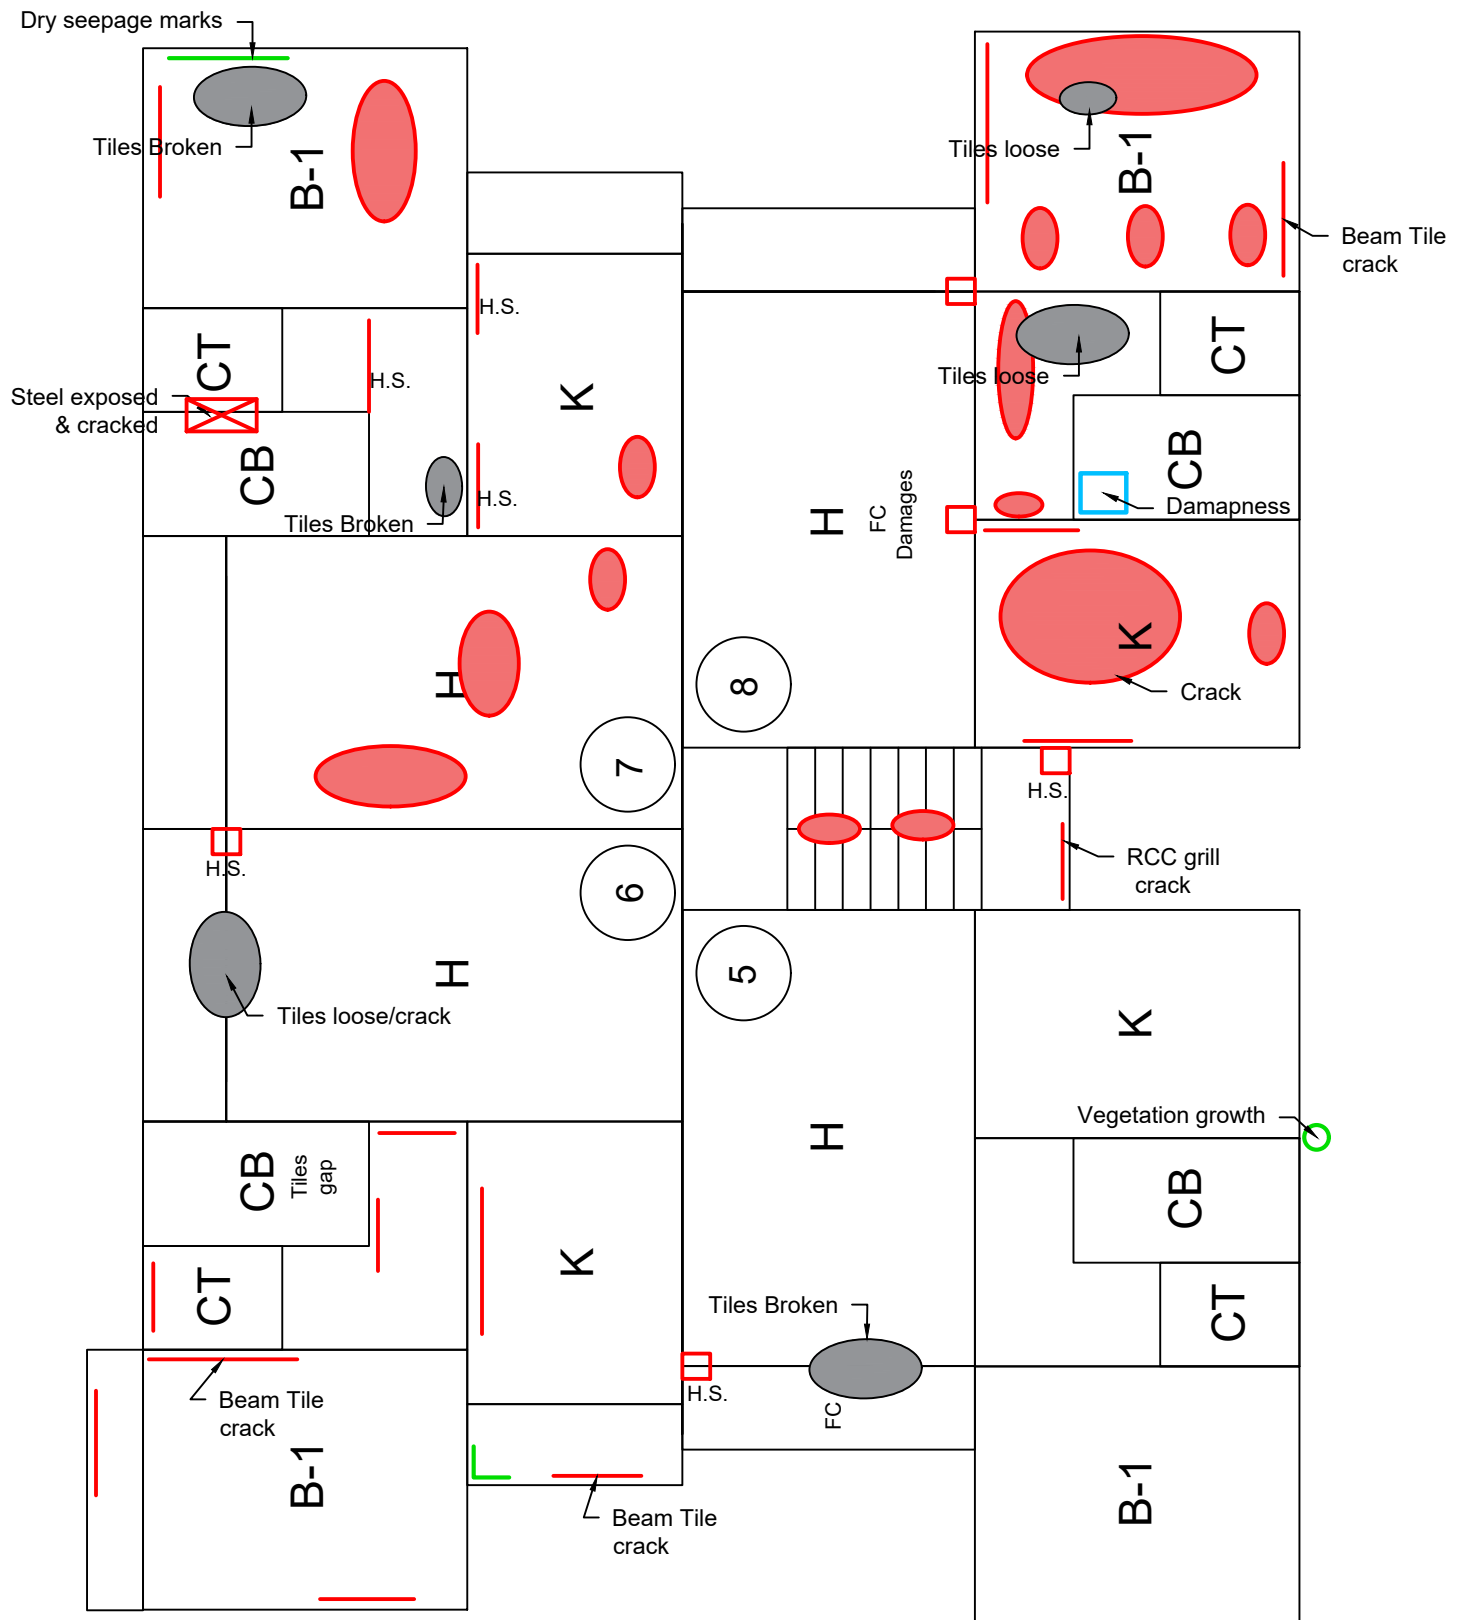

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

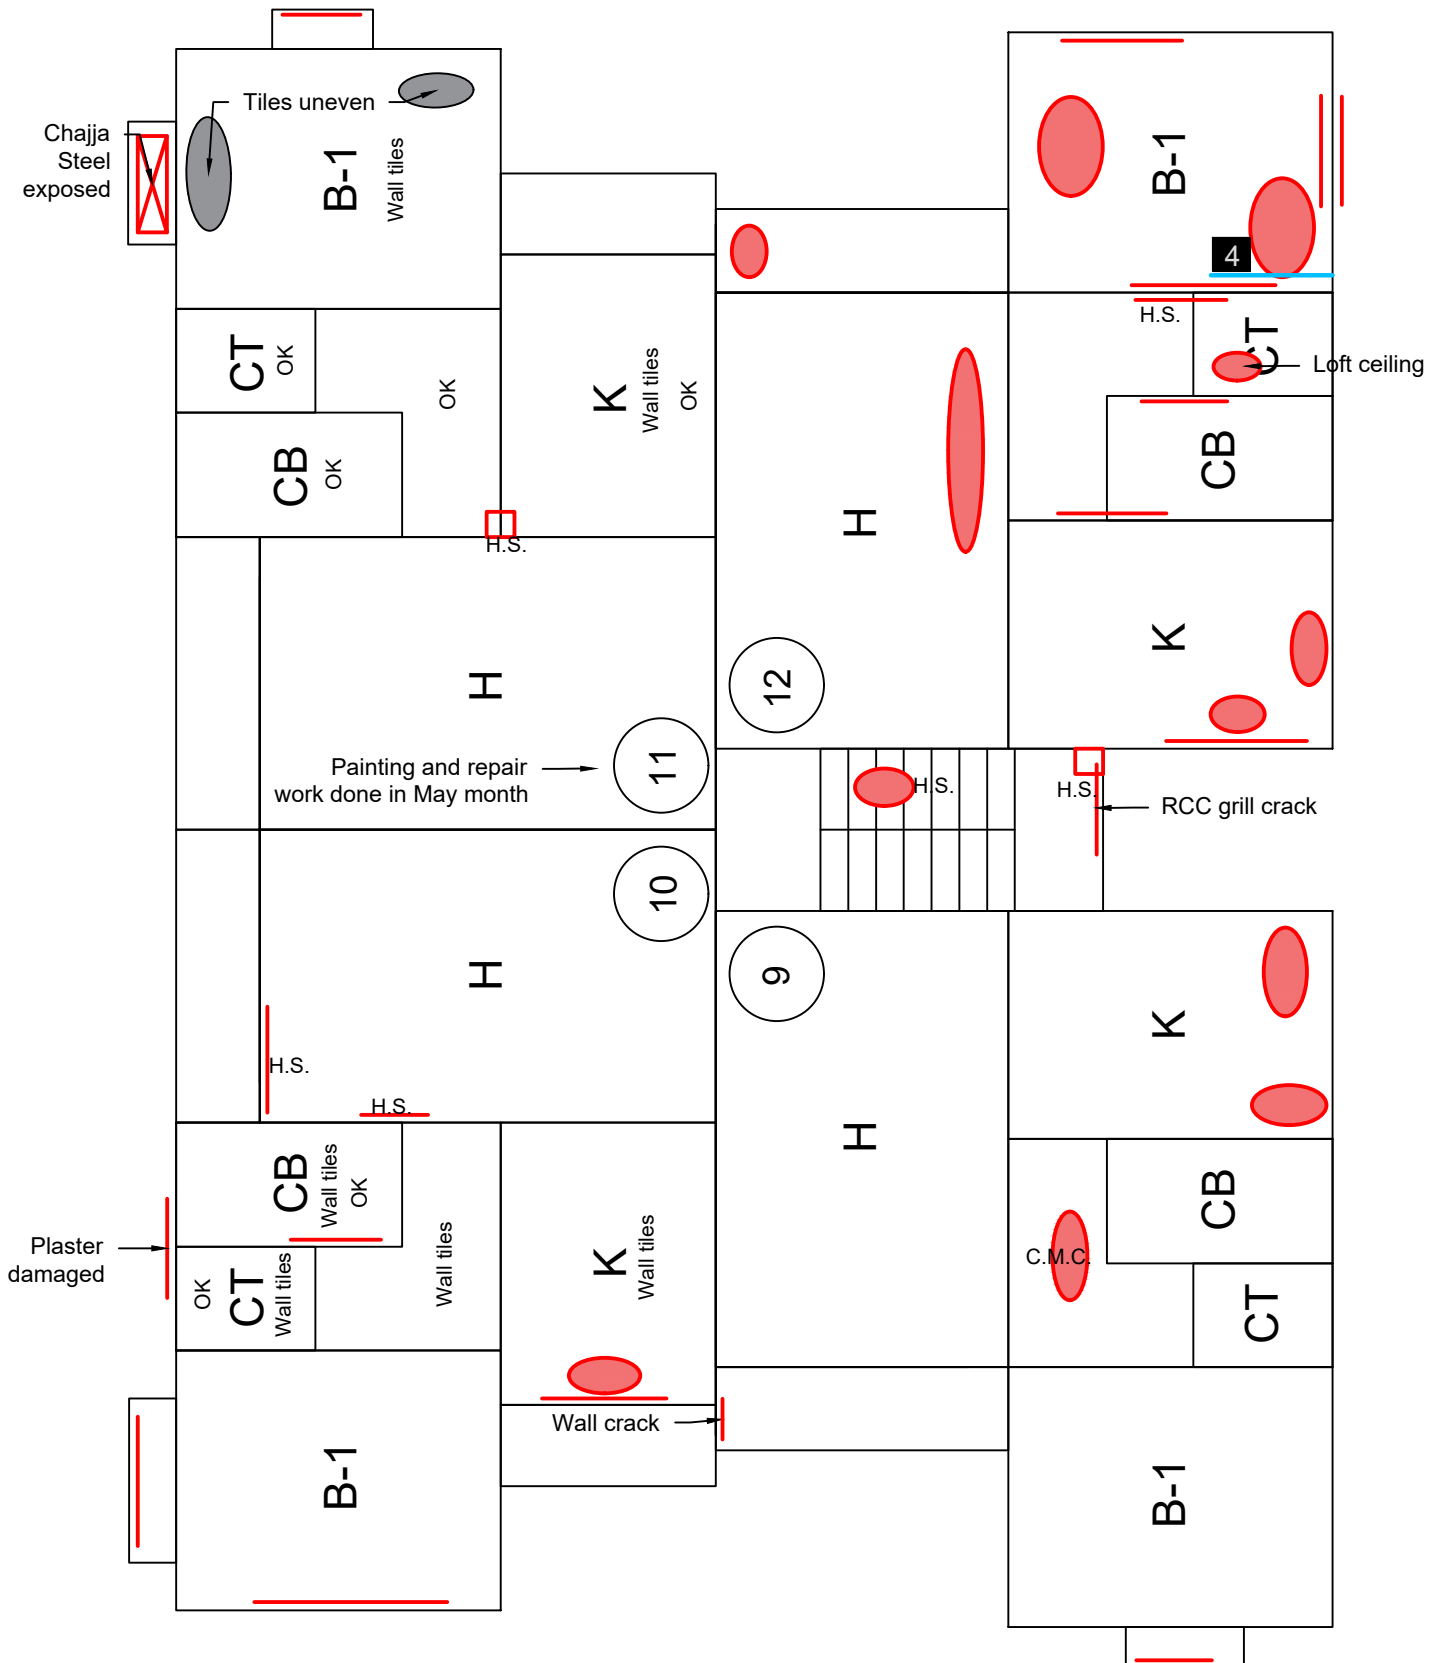

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

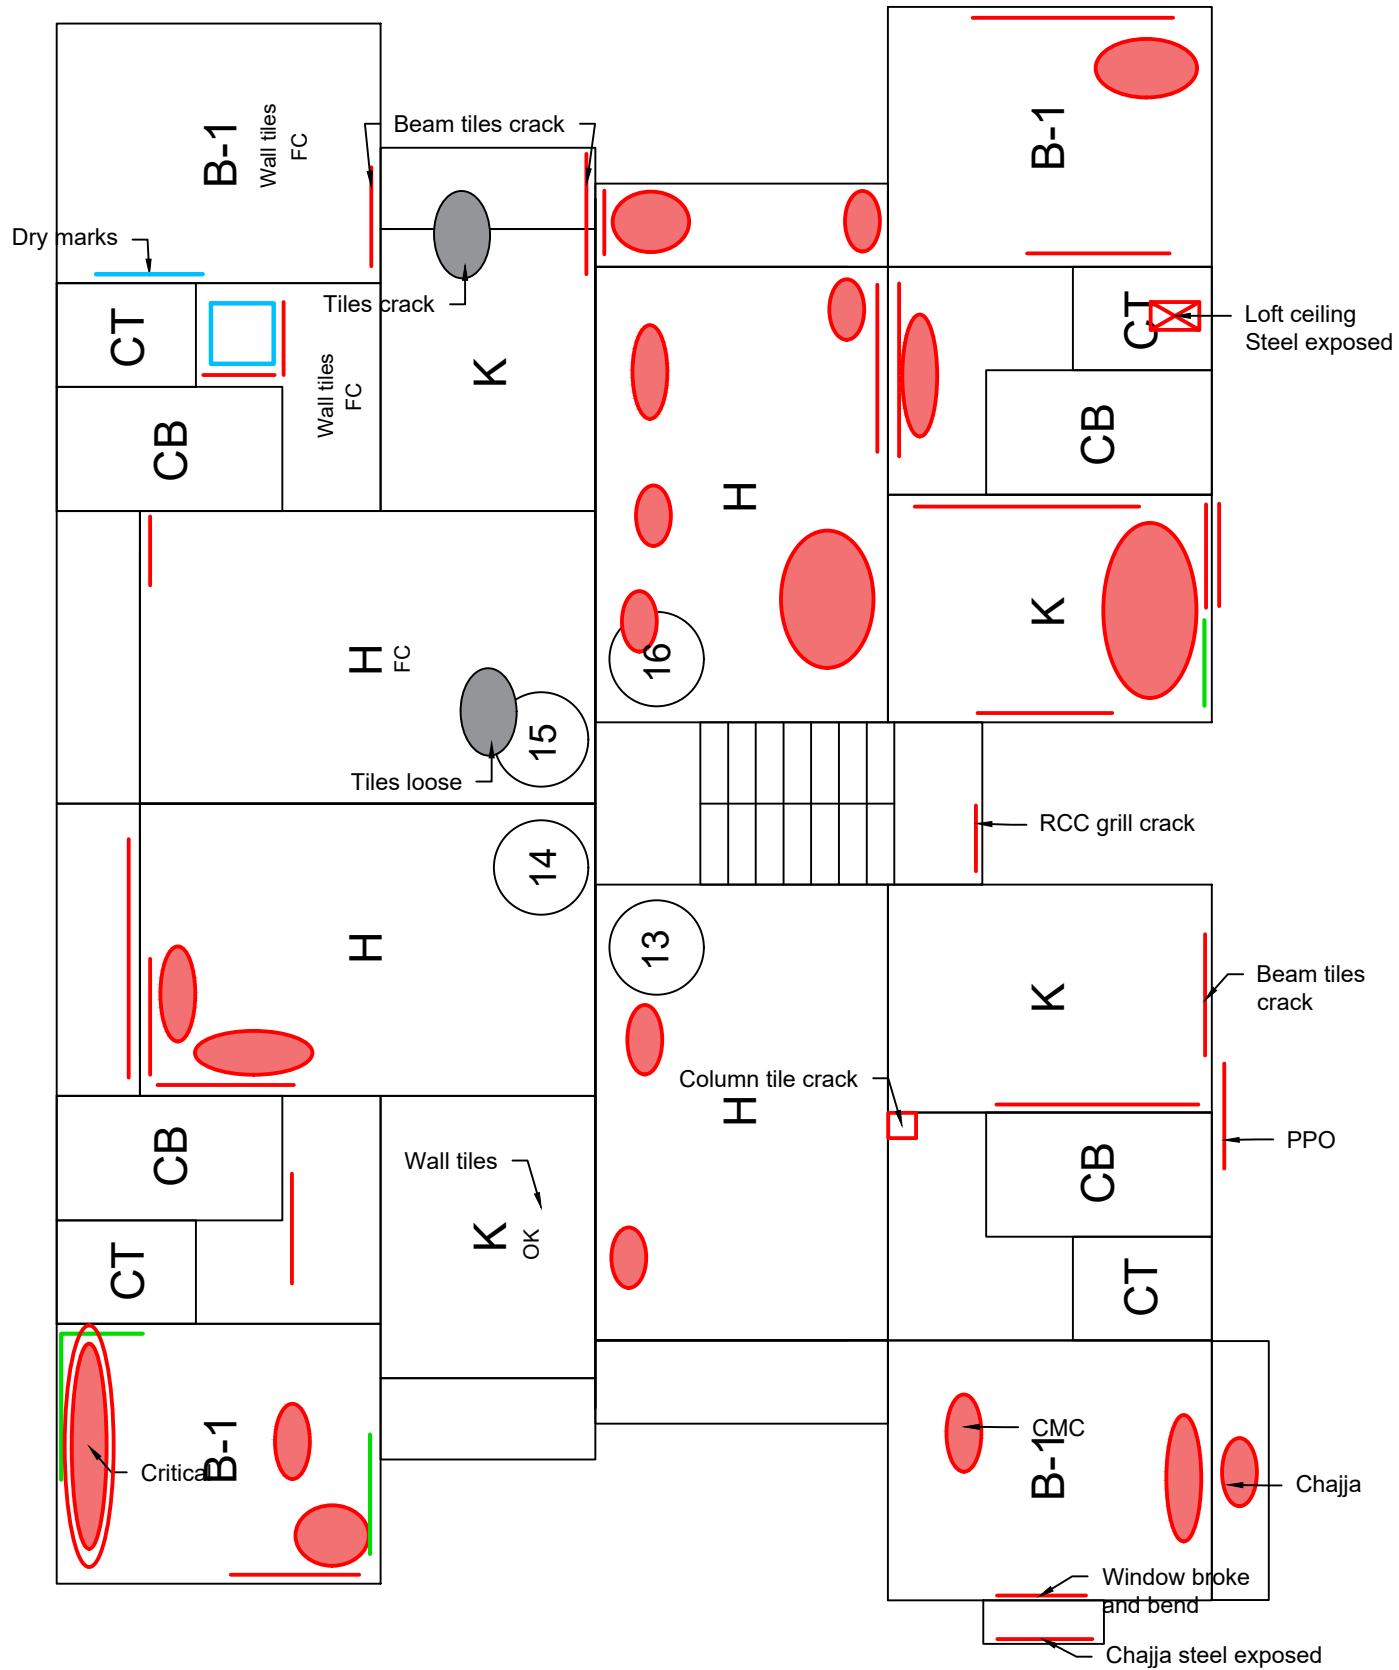

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

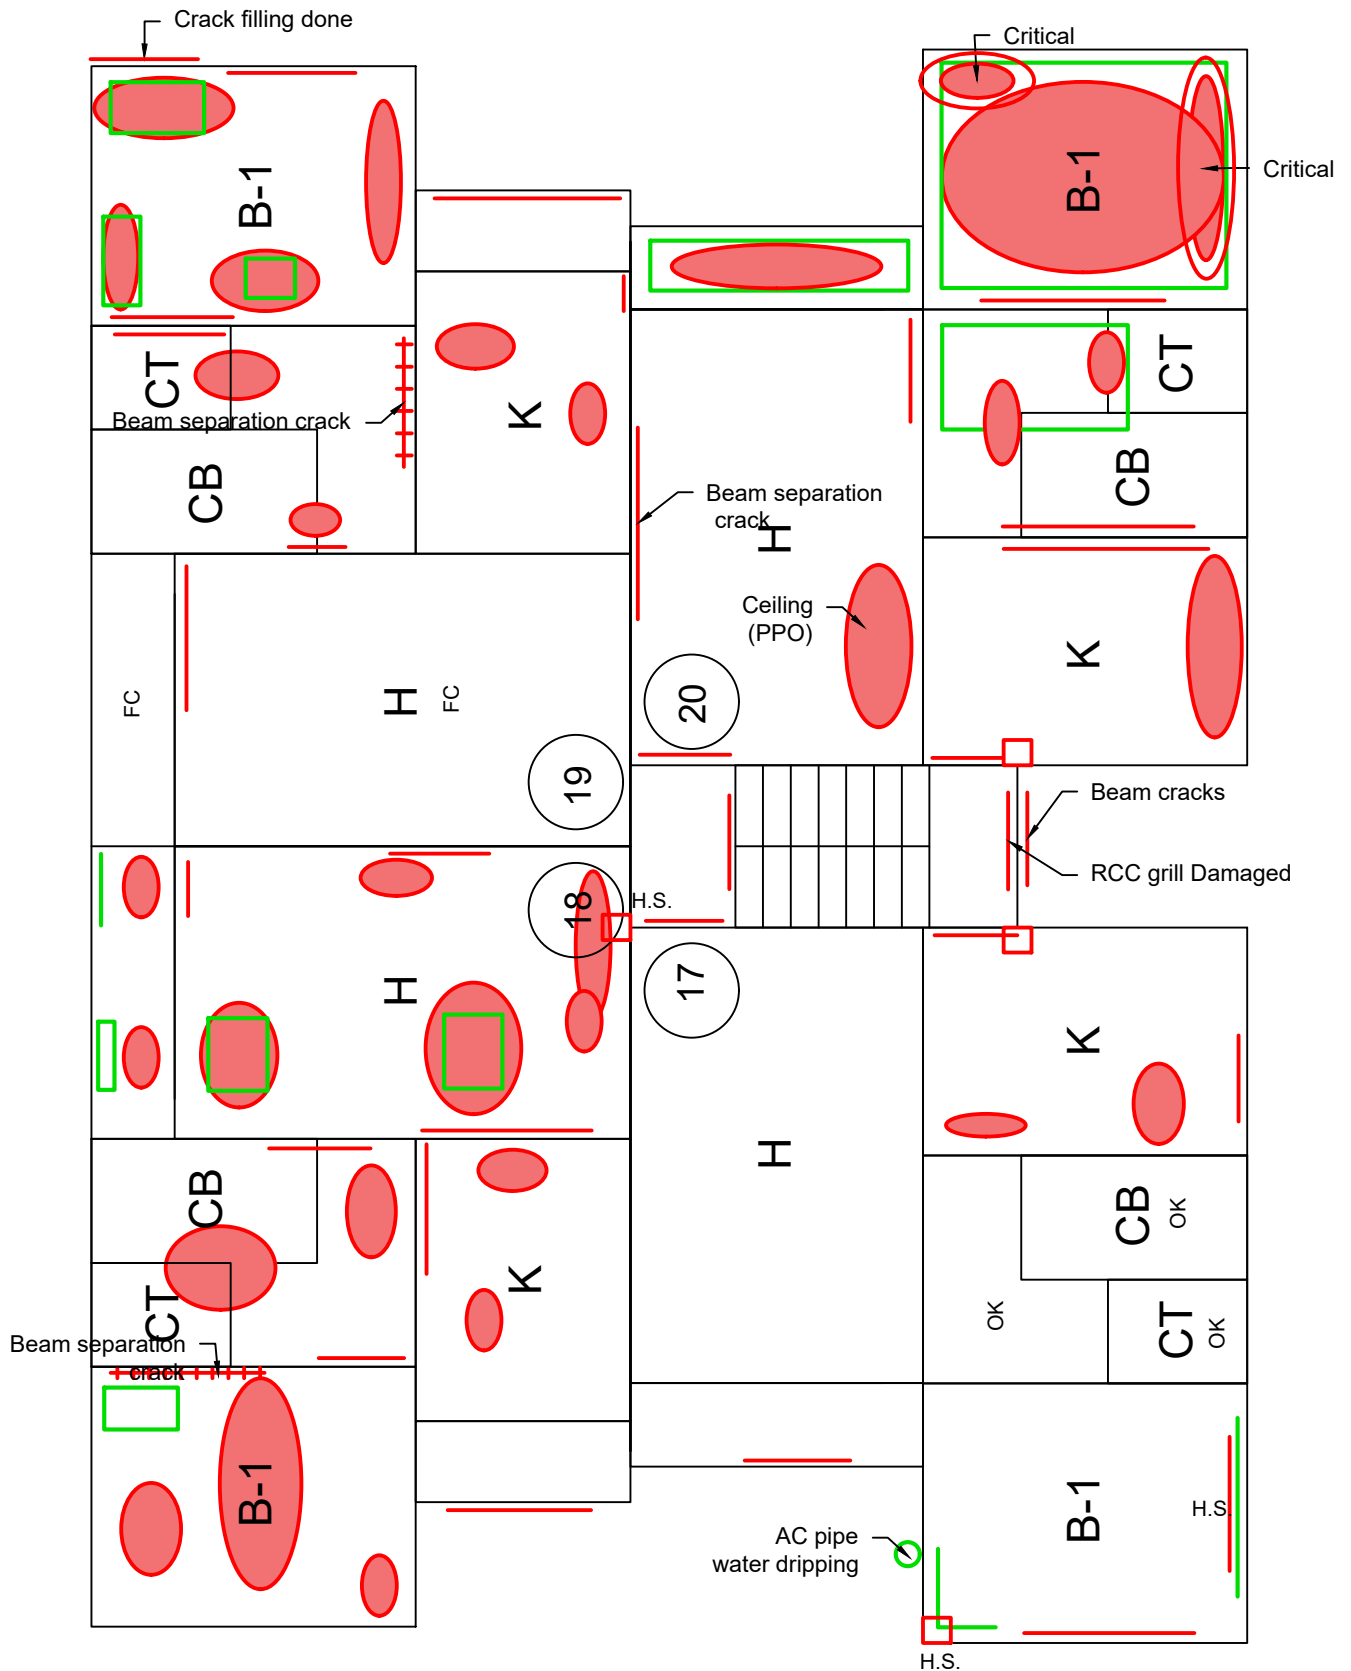

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

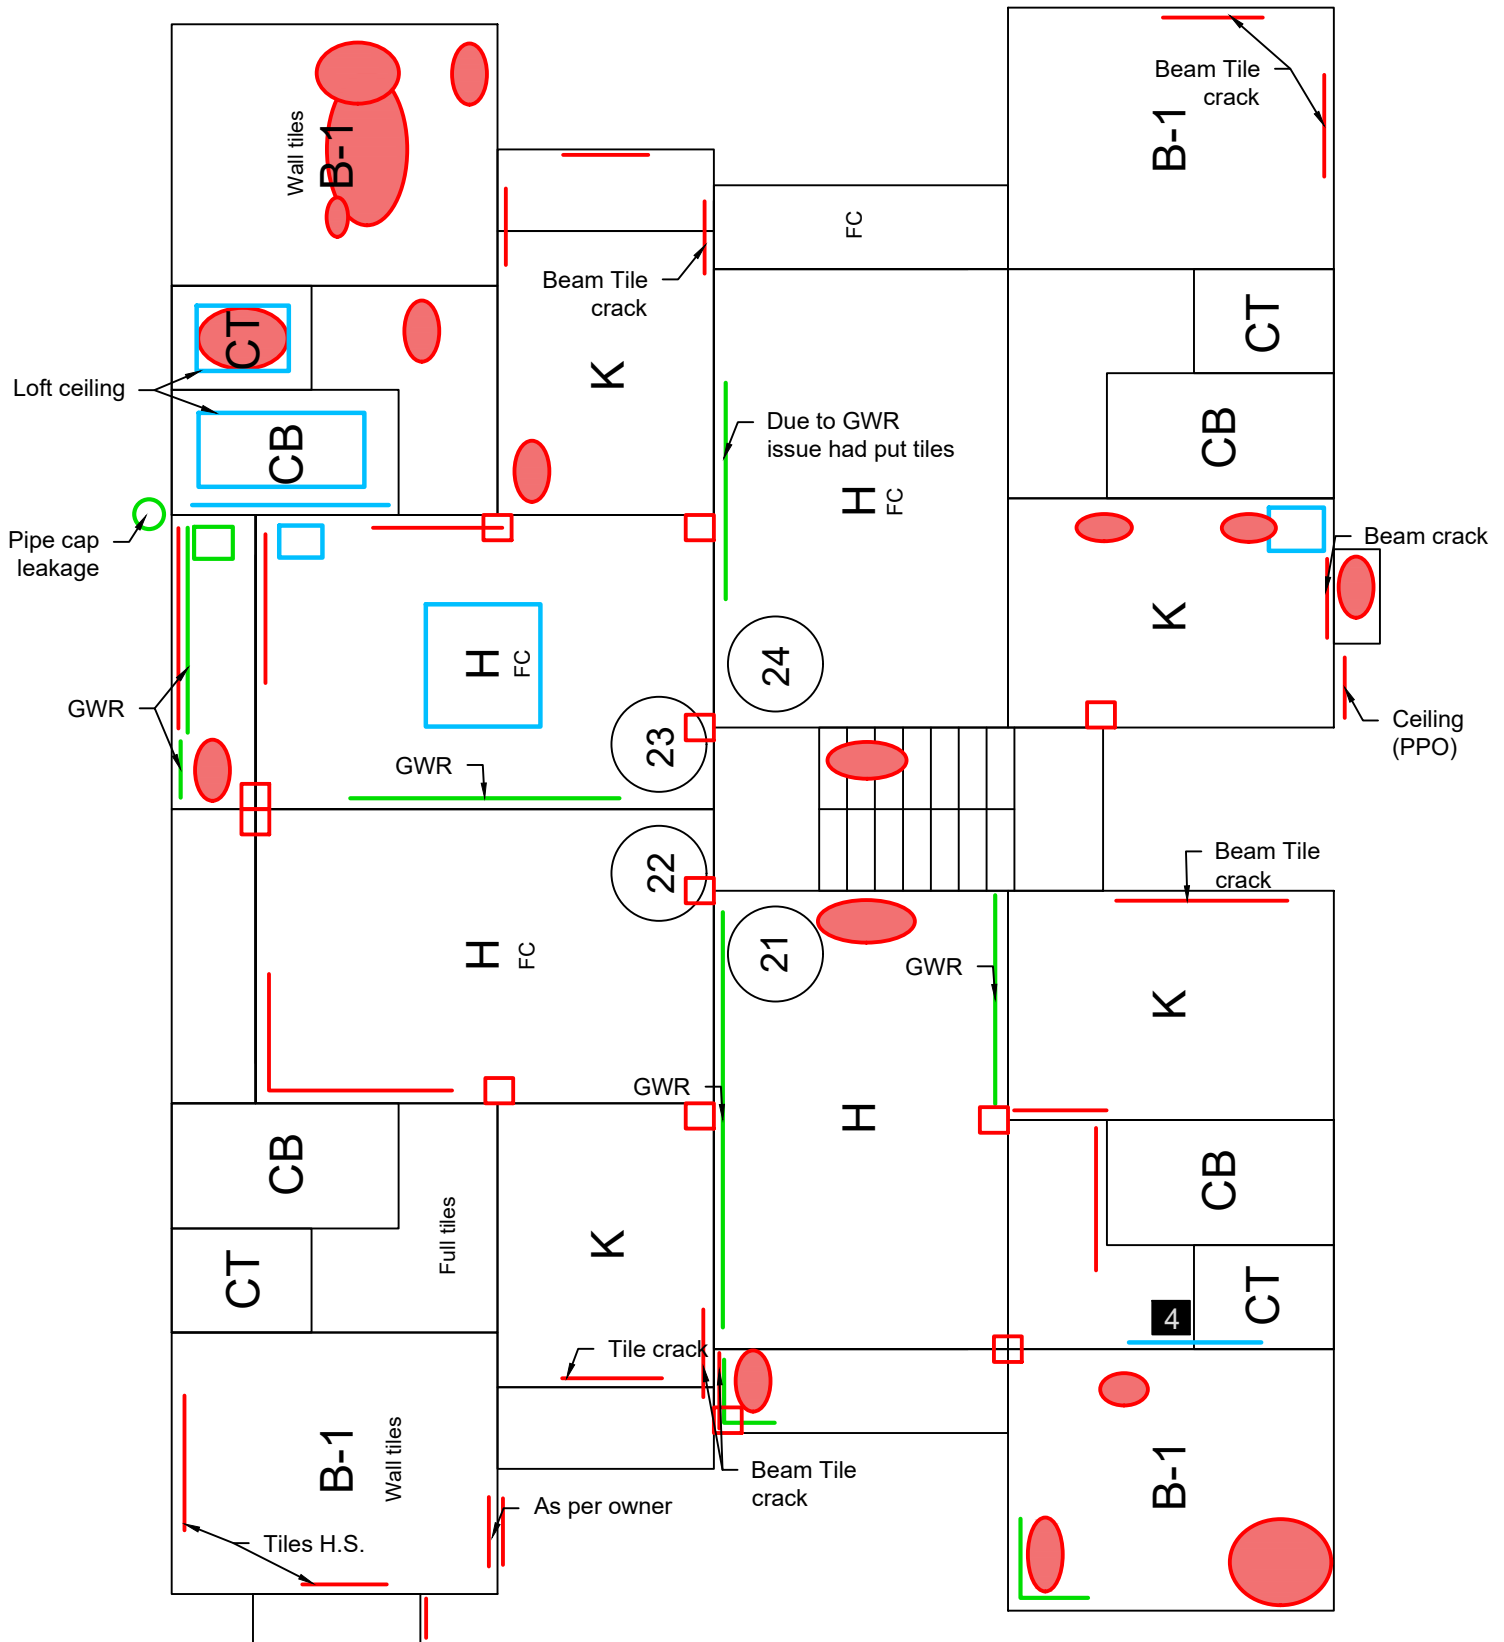

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

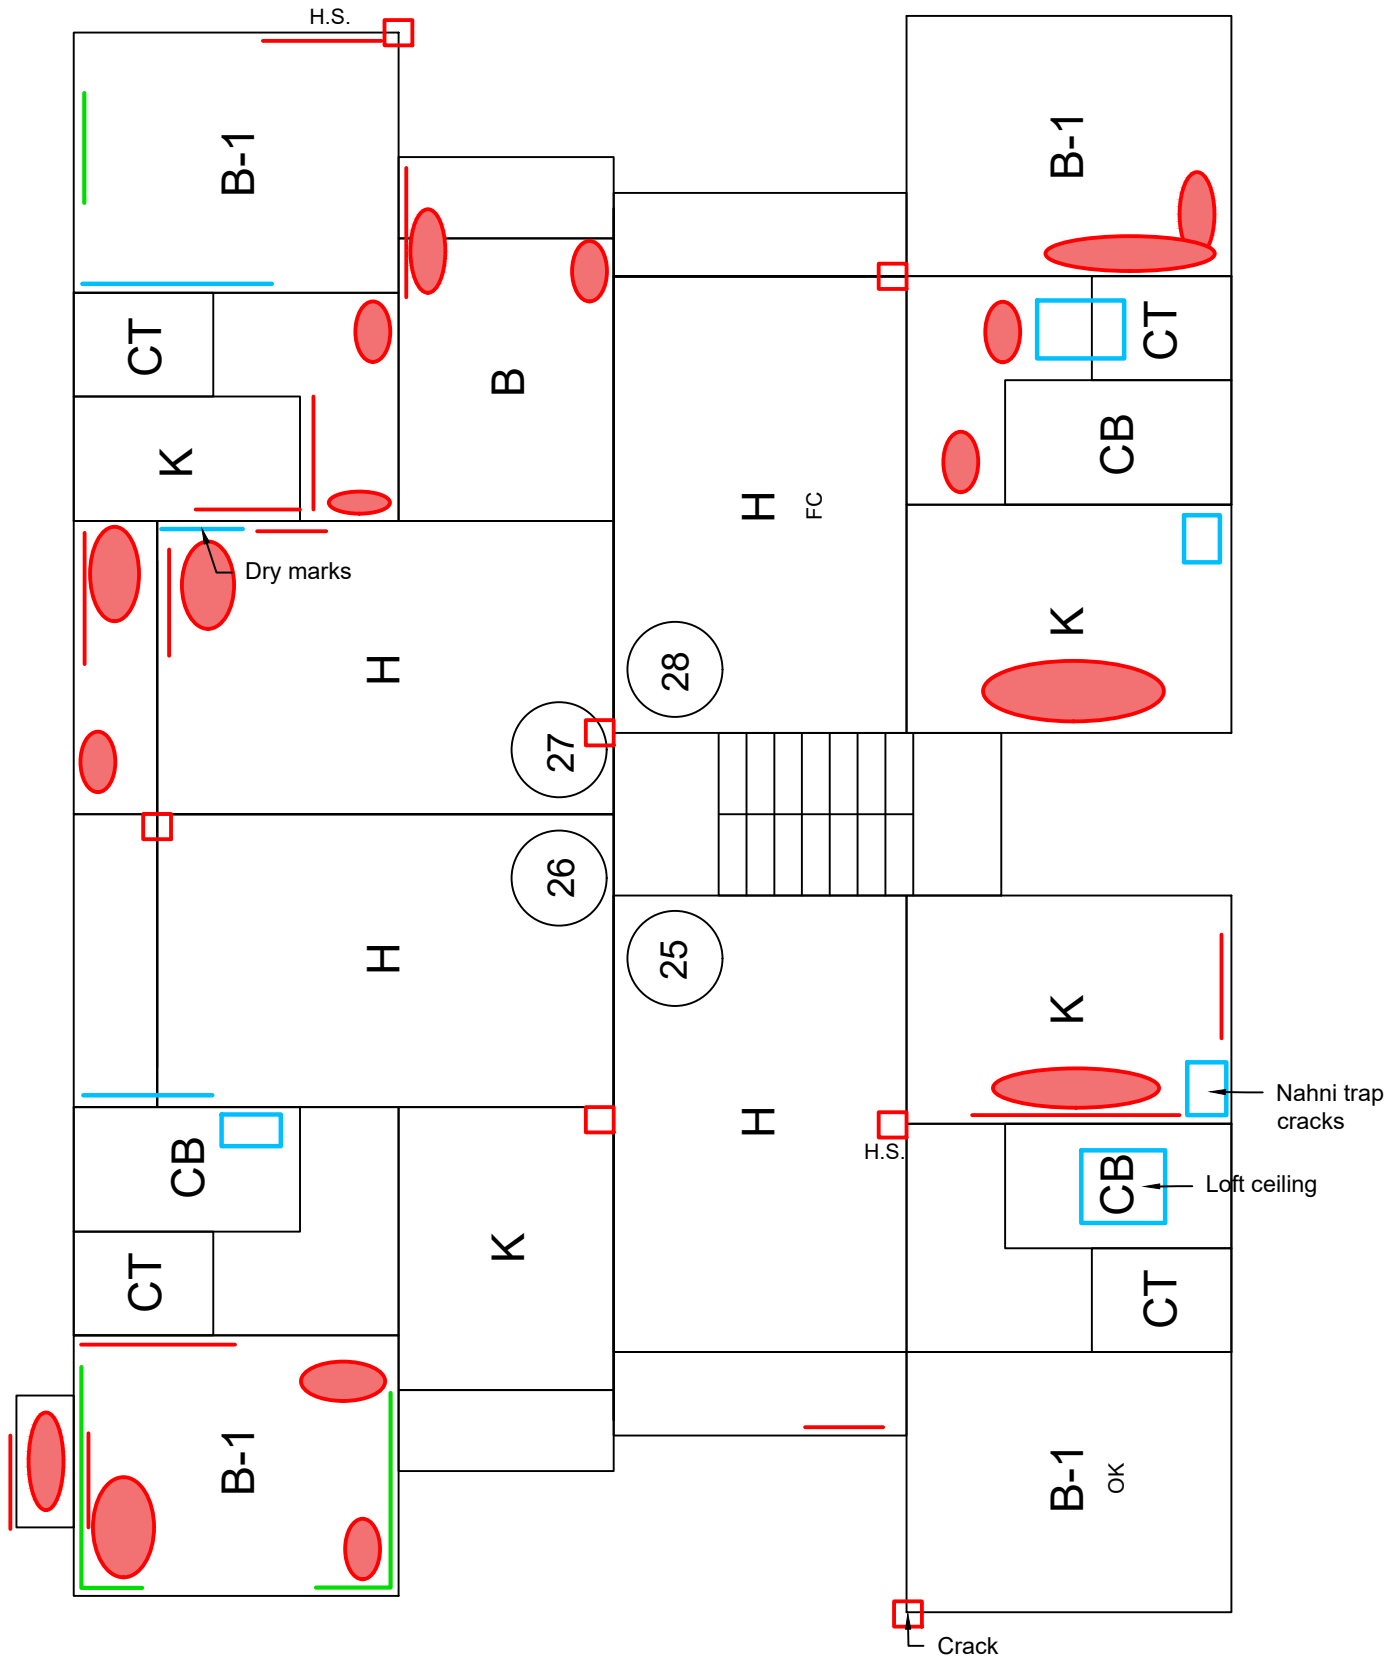

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nalni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

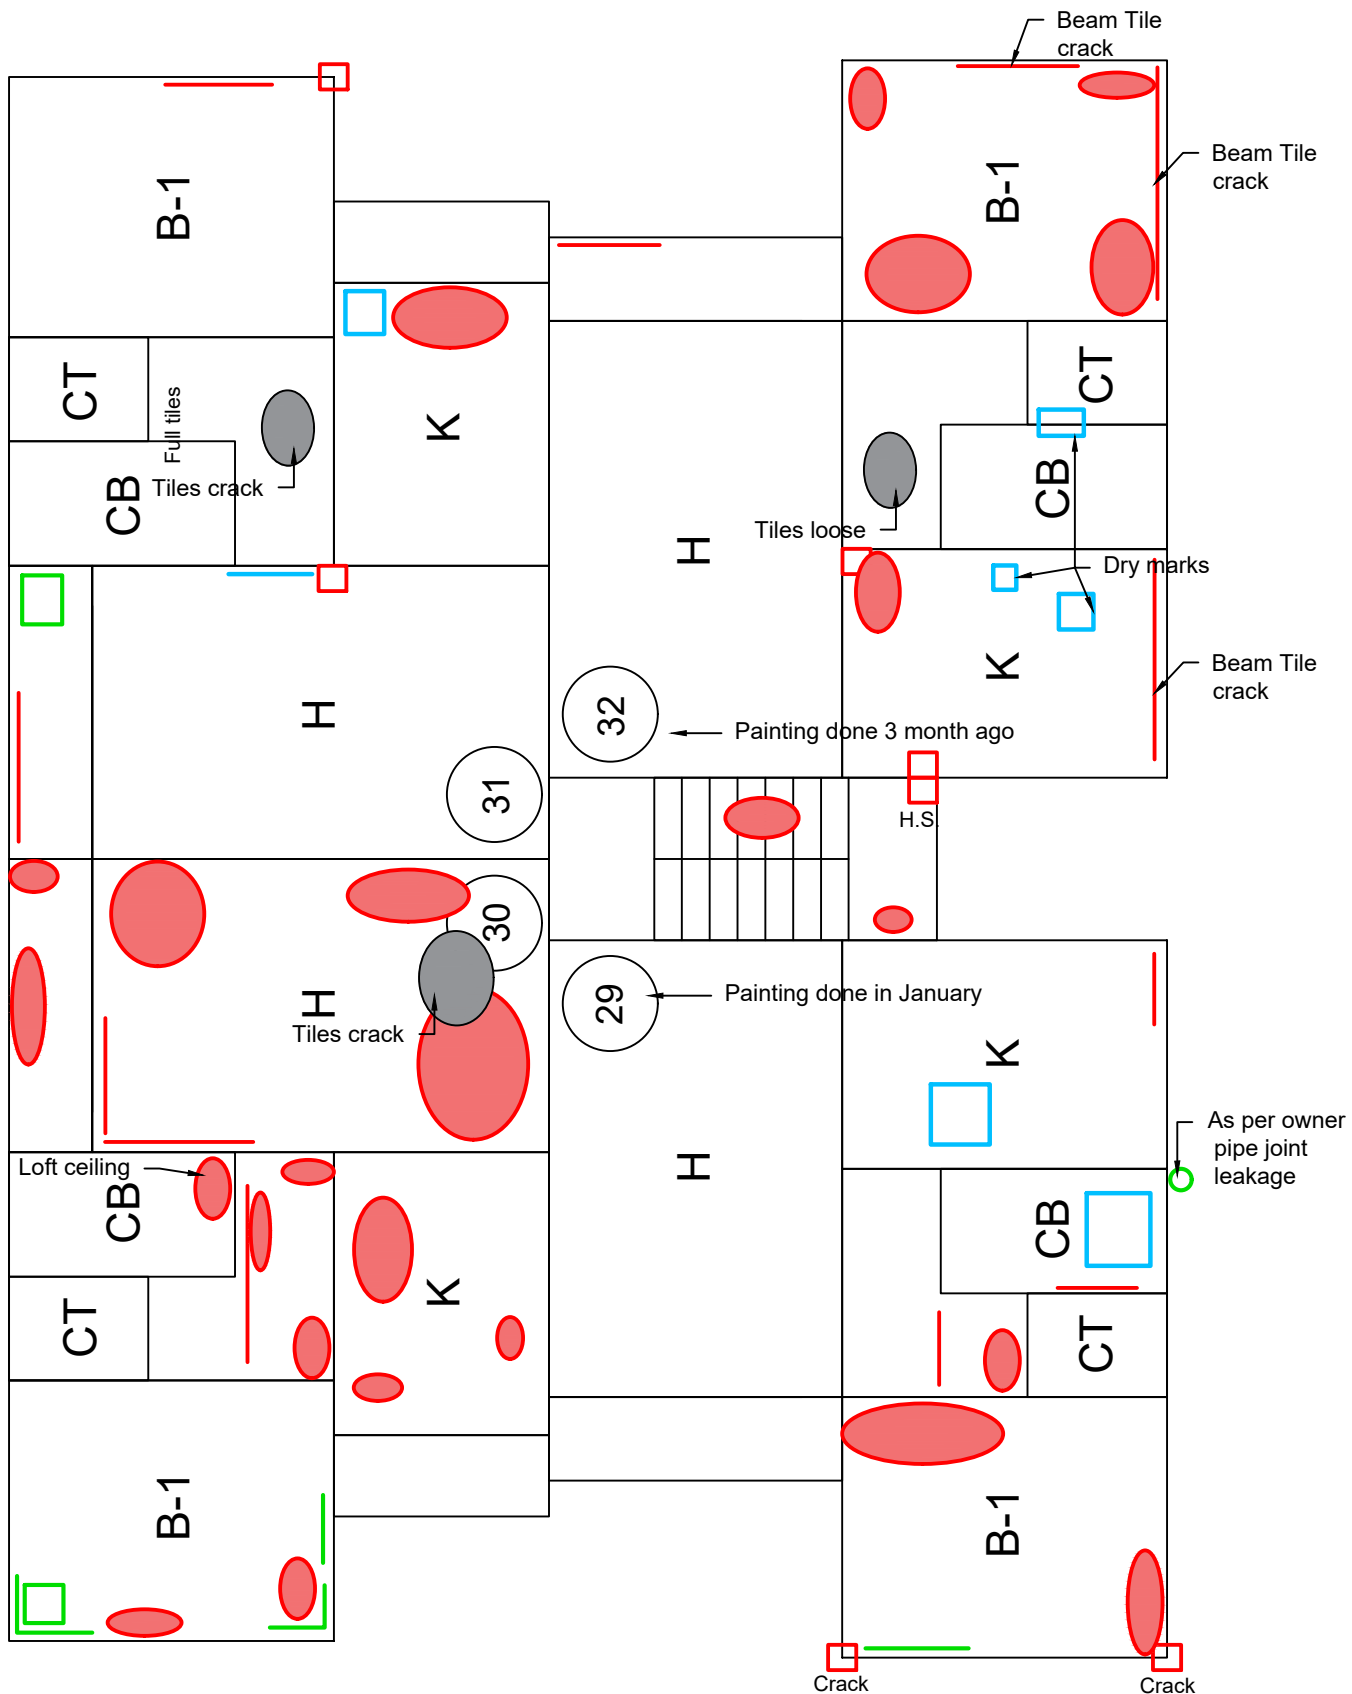


Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	

CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

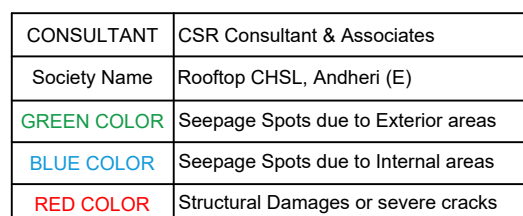


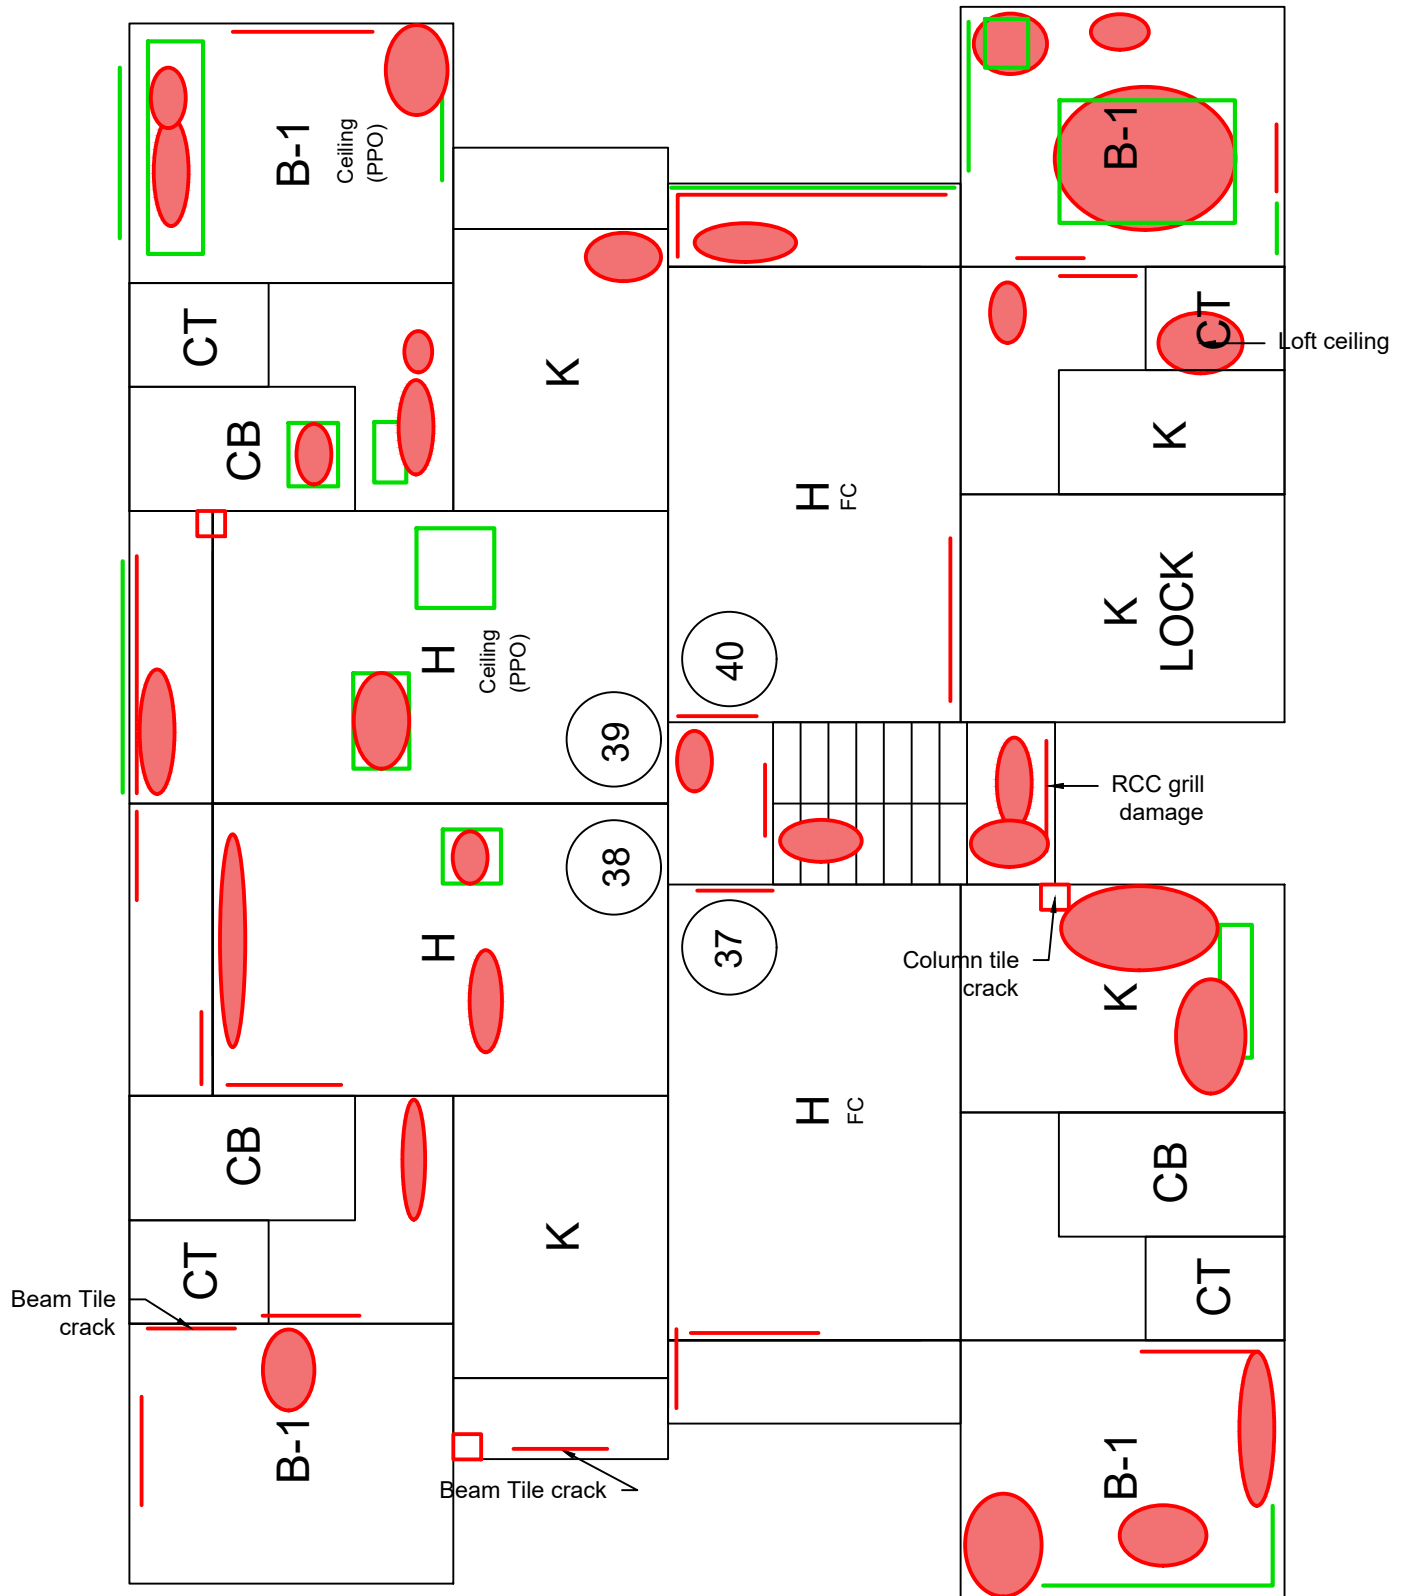

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	

CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

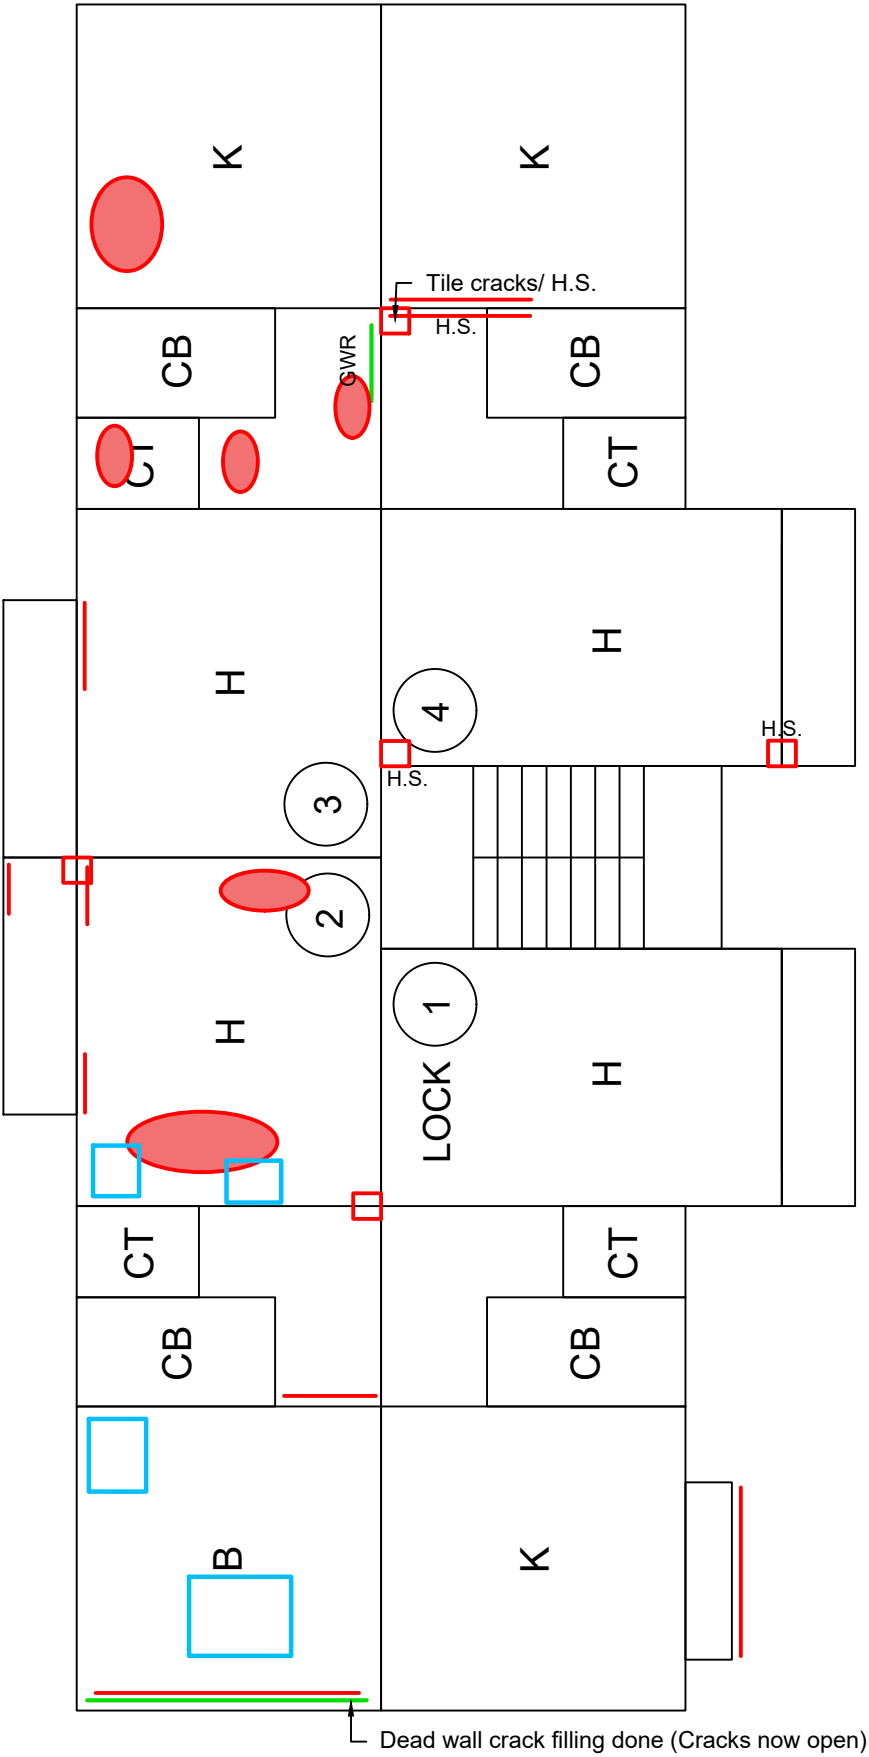


Dead wall crack filling done (Cracks now open)

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

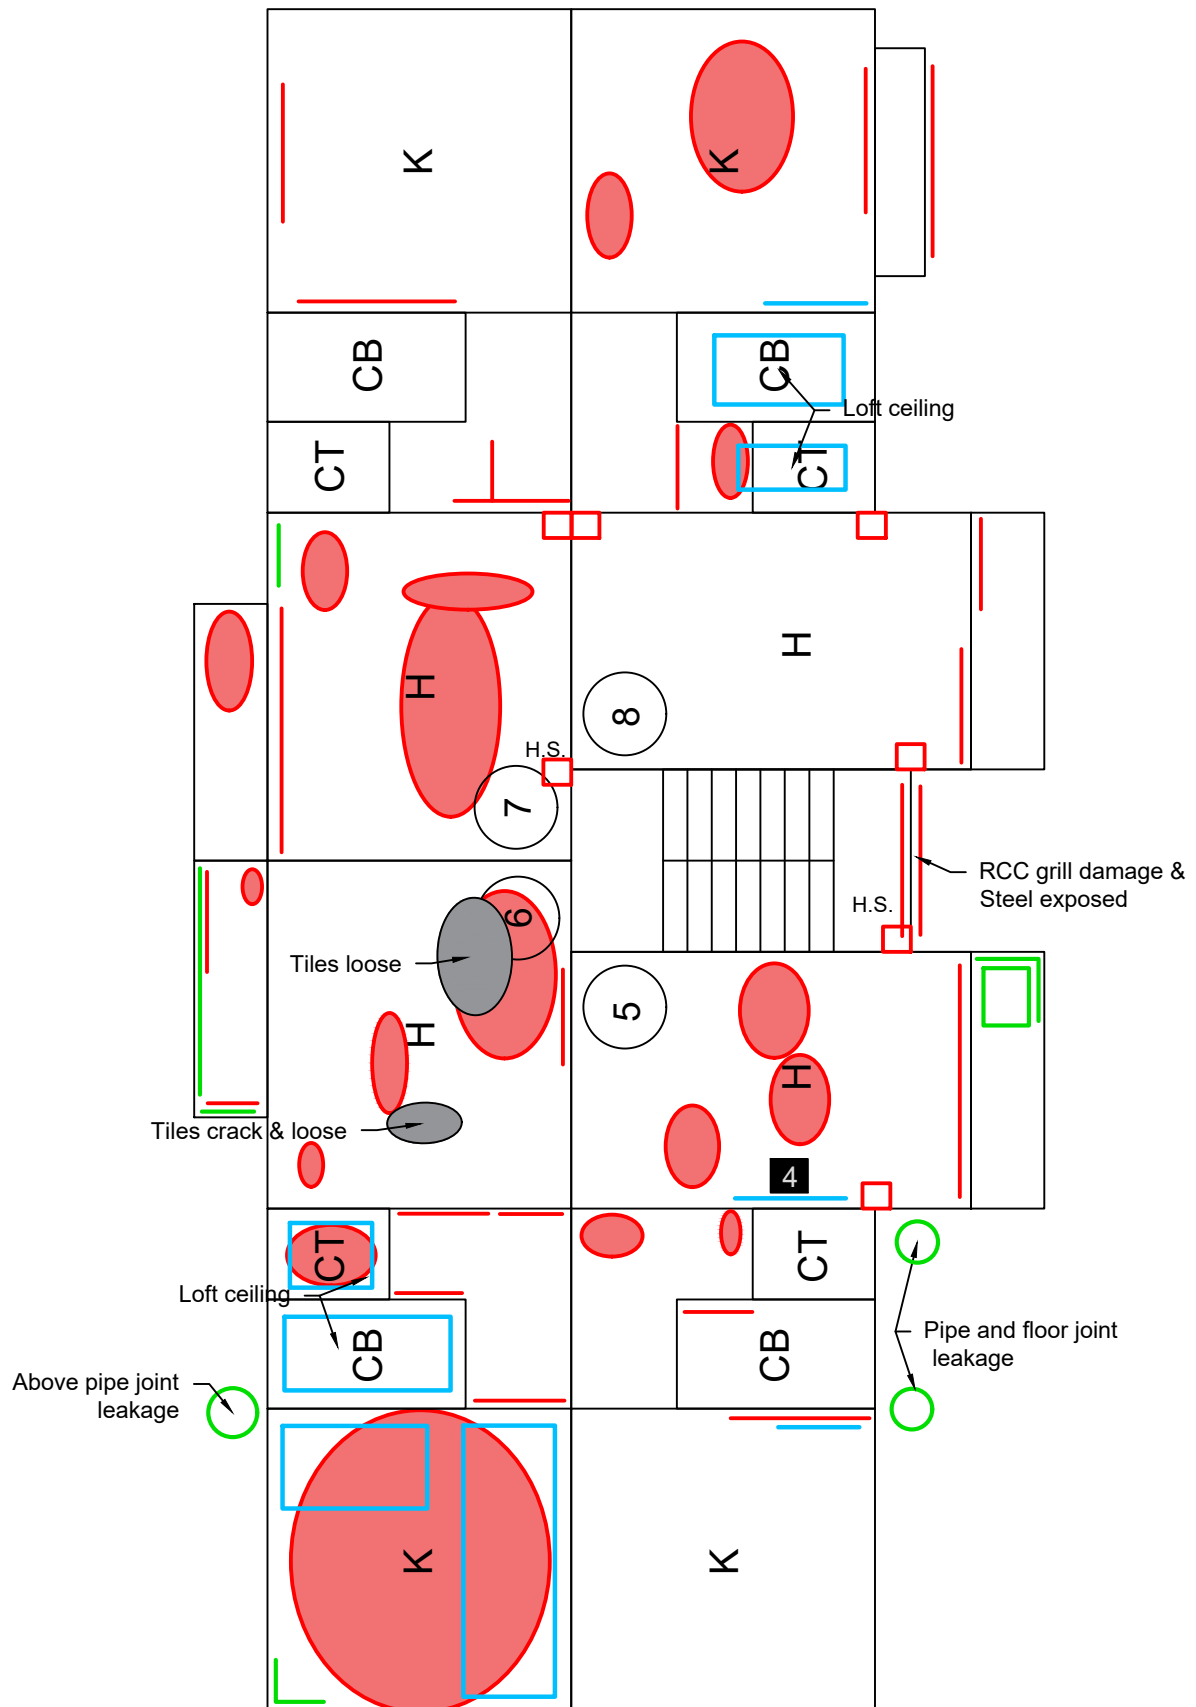

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

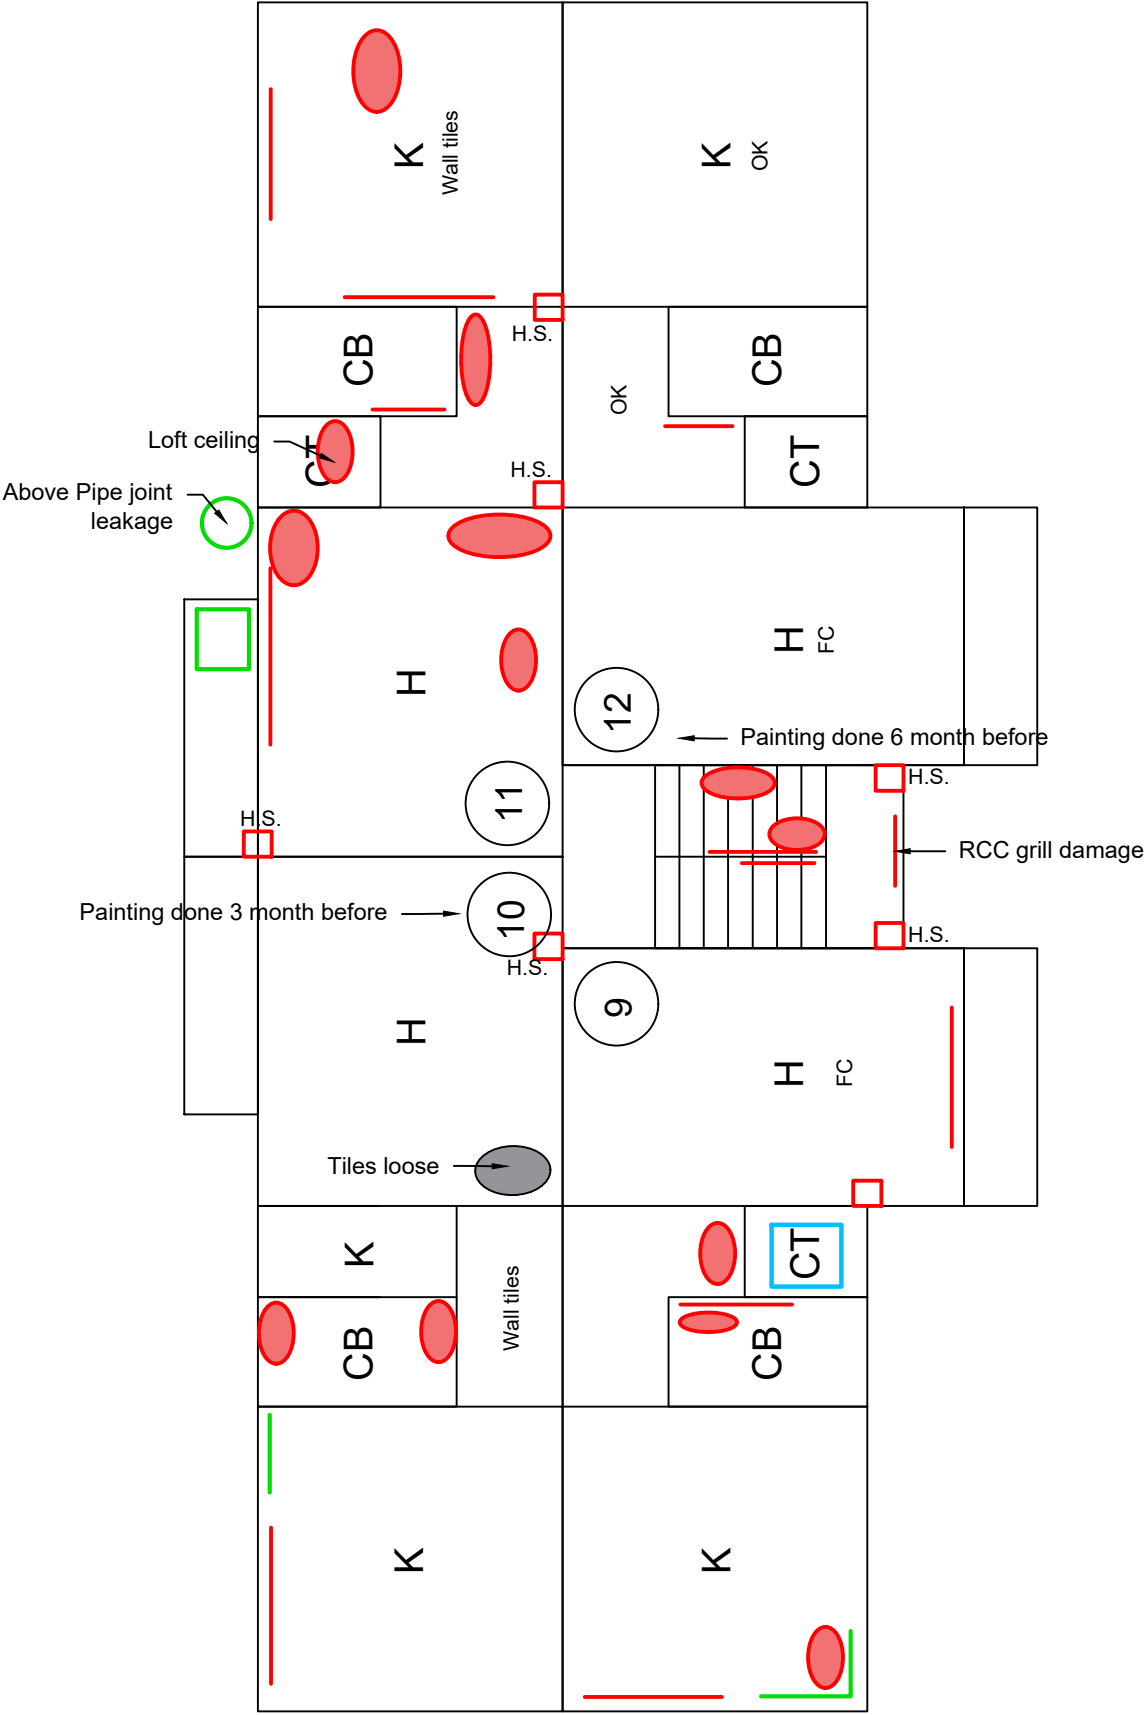

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

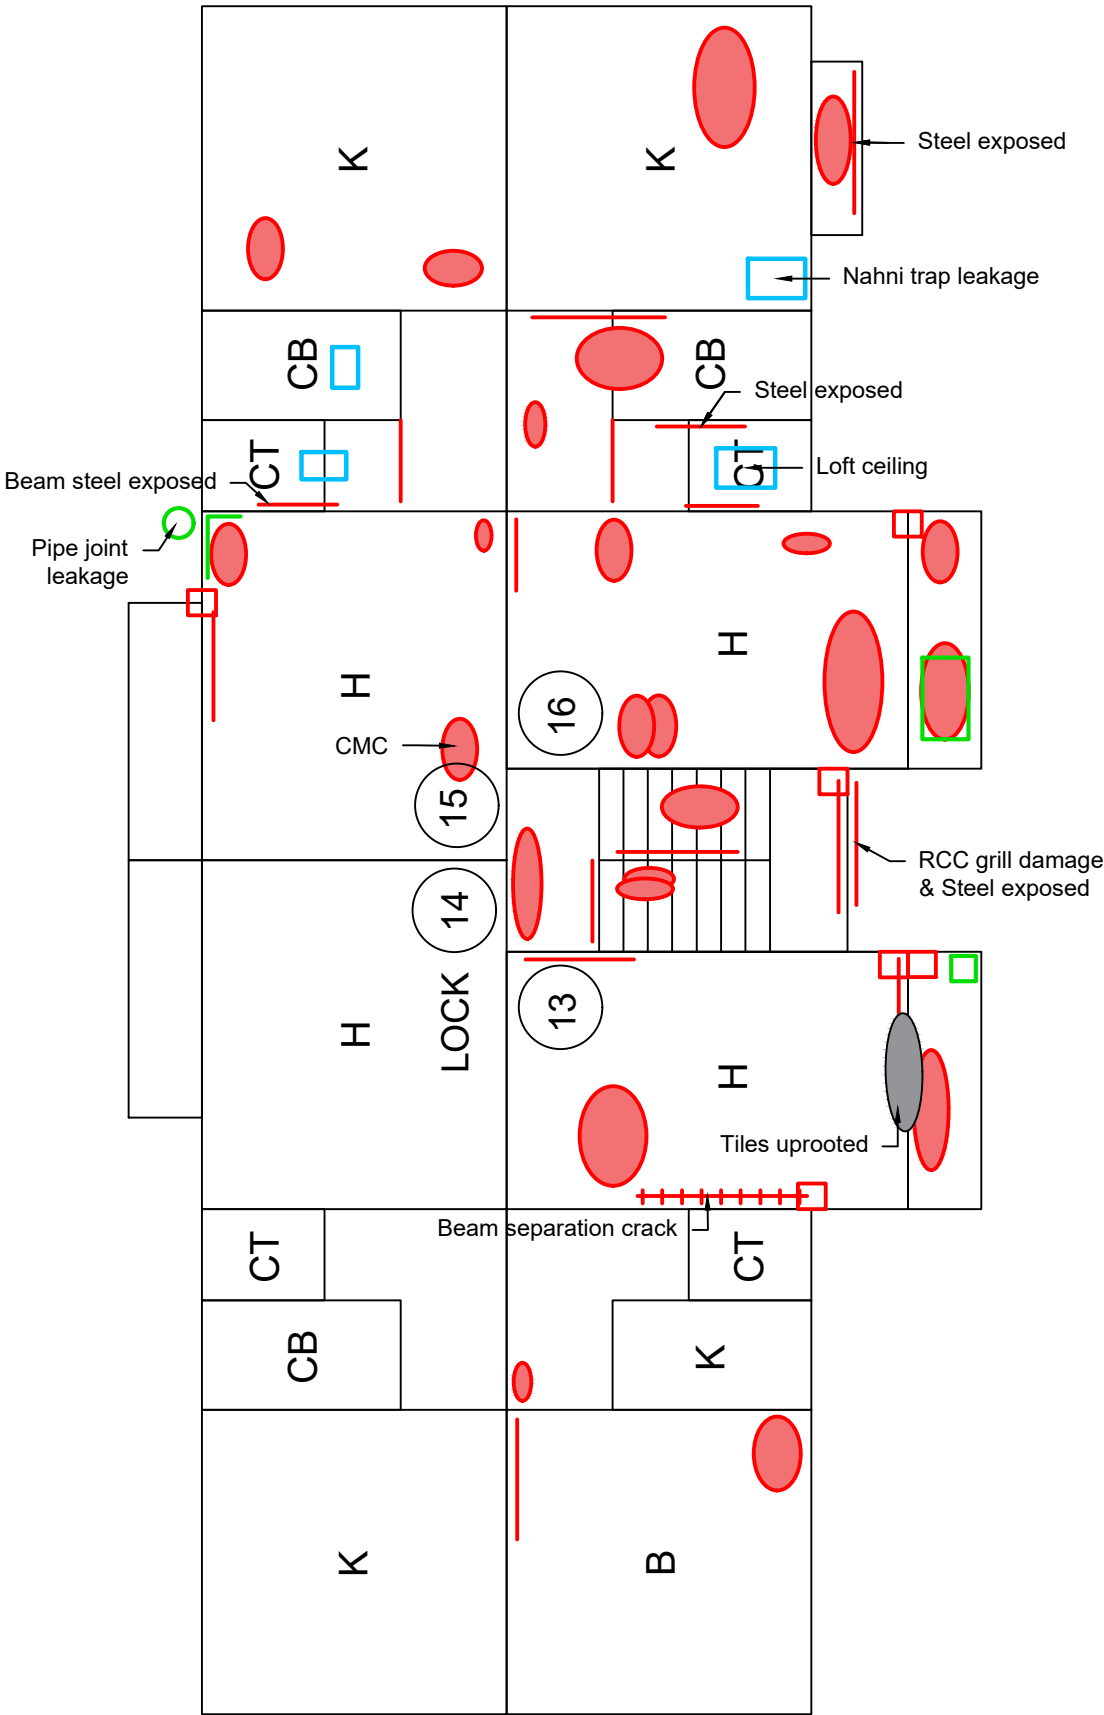


Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	

CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

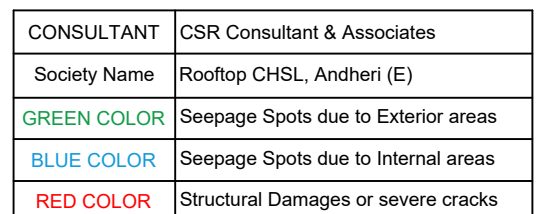


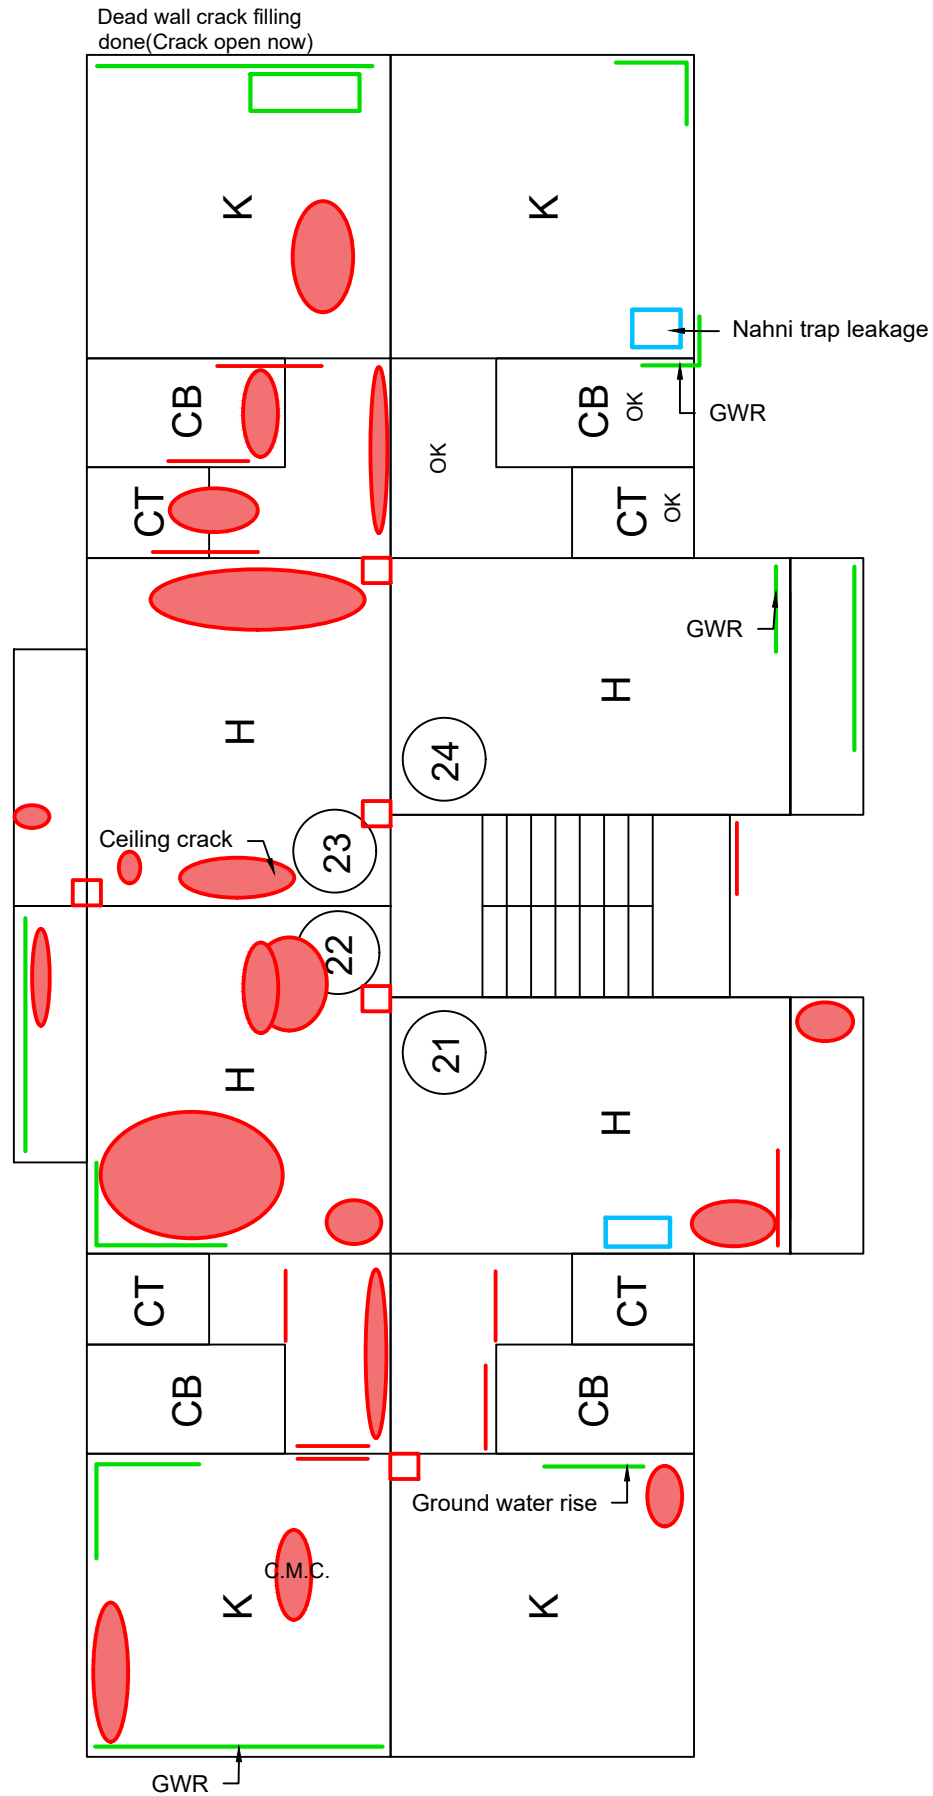

Steel framing provided ISMB/ISMC - Rusted	⊗
Reinforcement Steel exposed	⊗
Above Nahni Trap Ceiling area	3
Side Skirting level Internal dampness	4
Door Frame damaged/Rotten	■

Column Structural Damages	□
Beam Structural Damages	—
Ceiling Structural Damages	●
Floor Structural Damages	●
Separation Crack	+++++


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

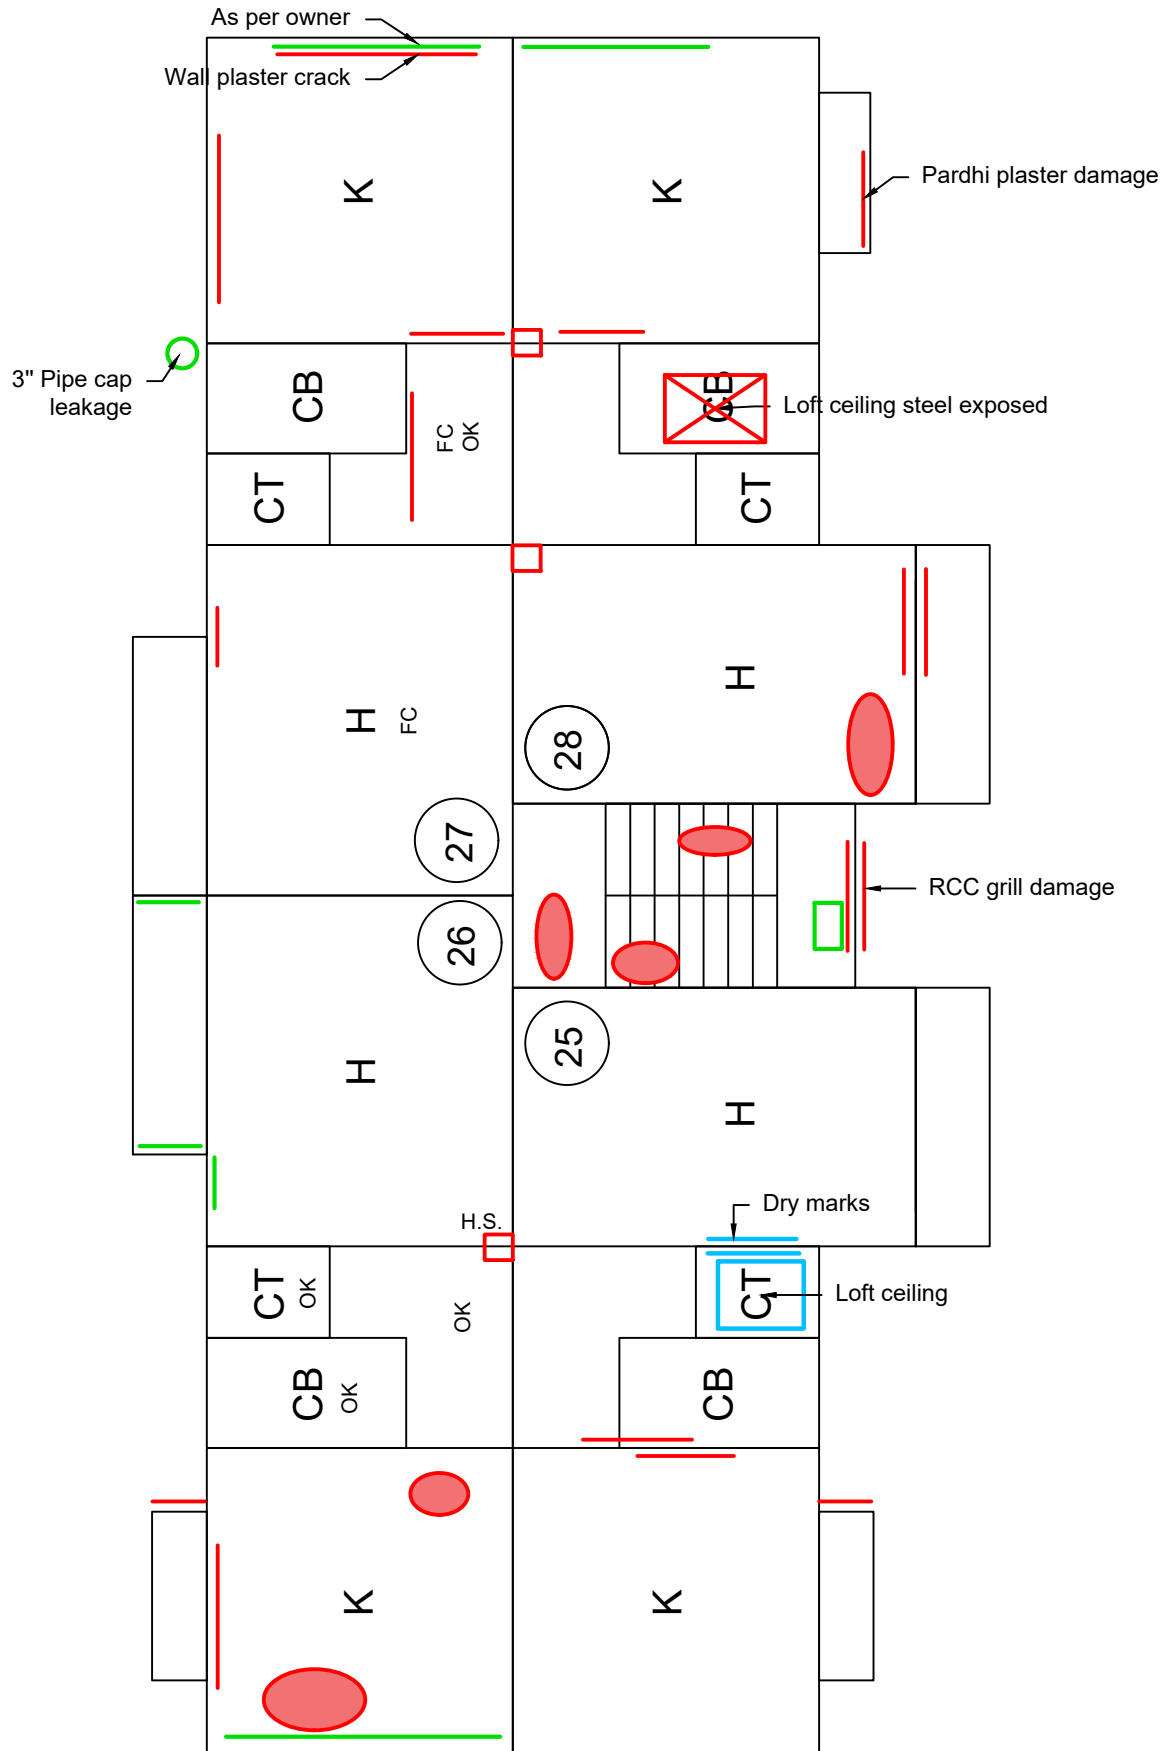

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	


CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

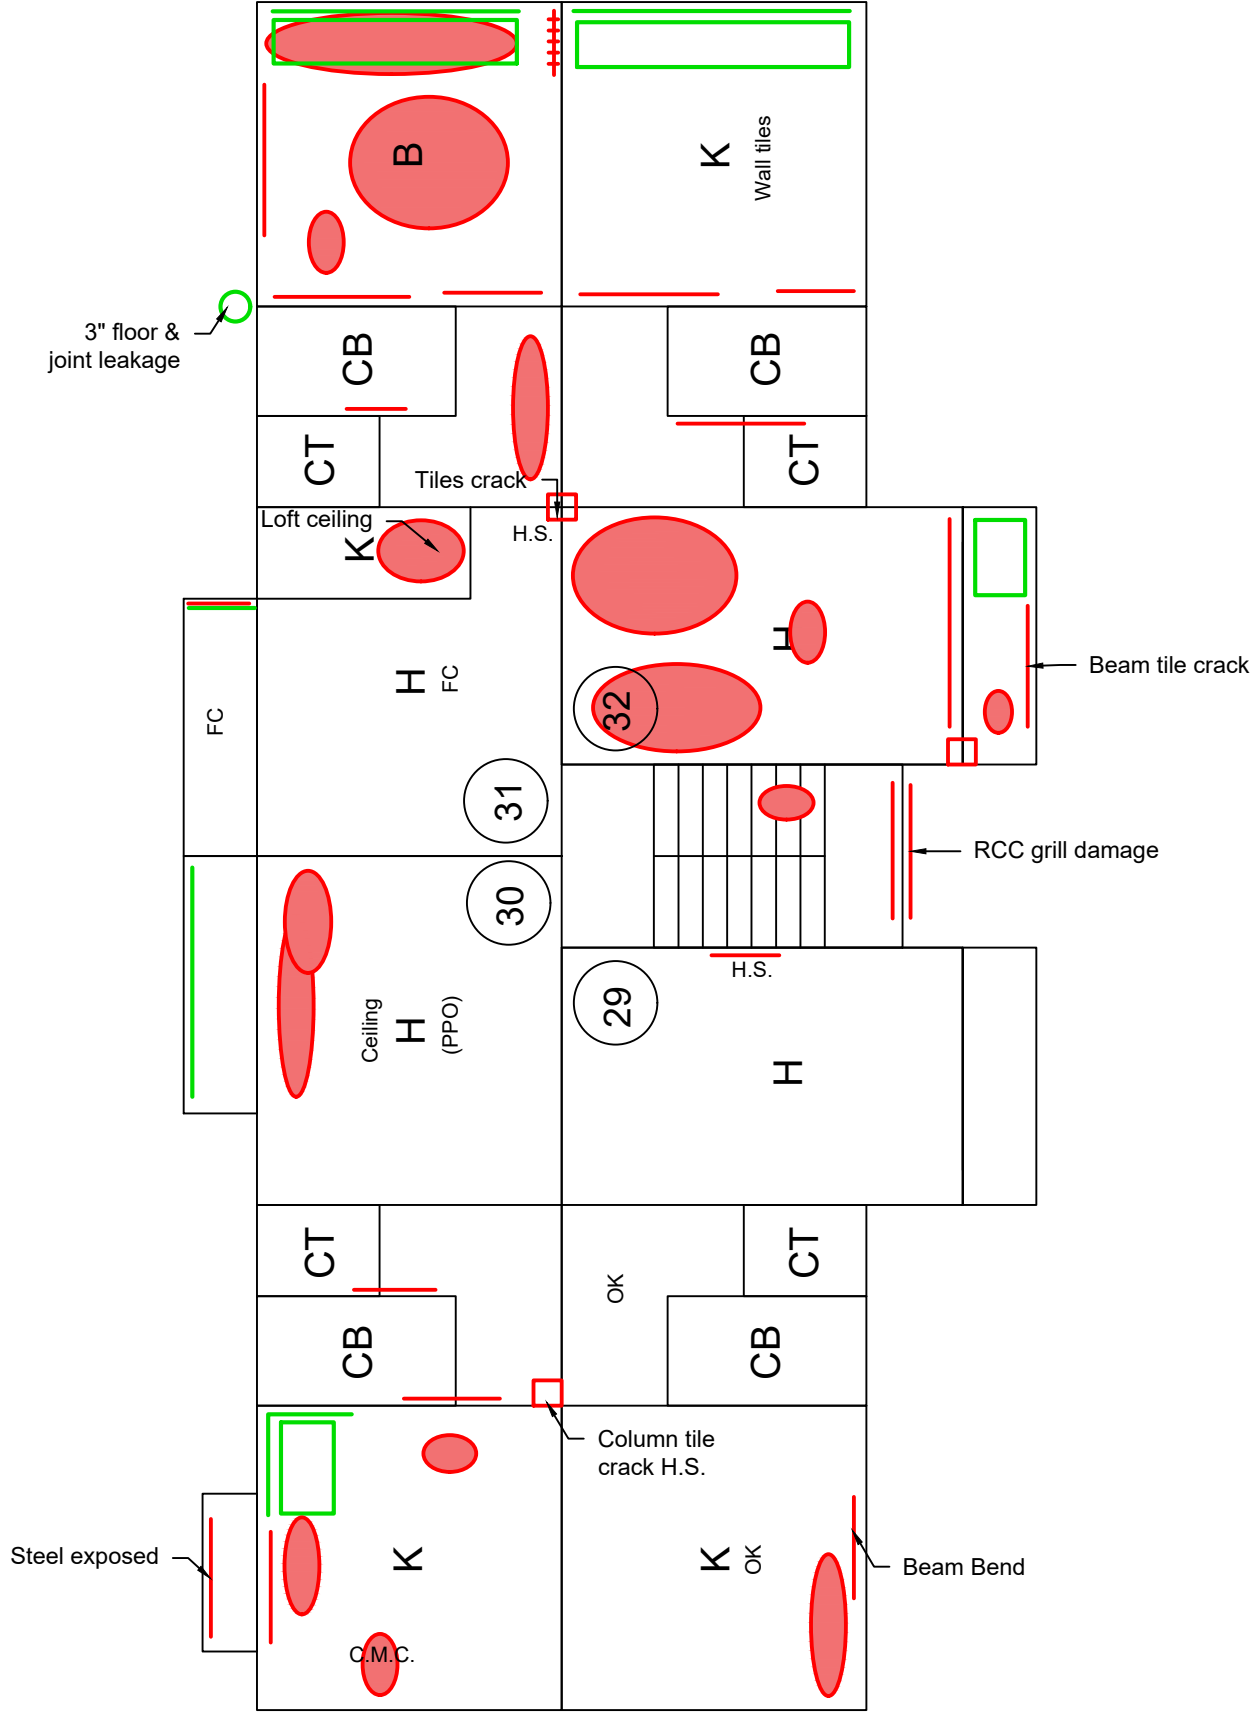

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	

CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

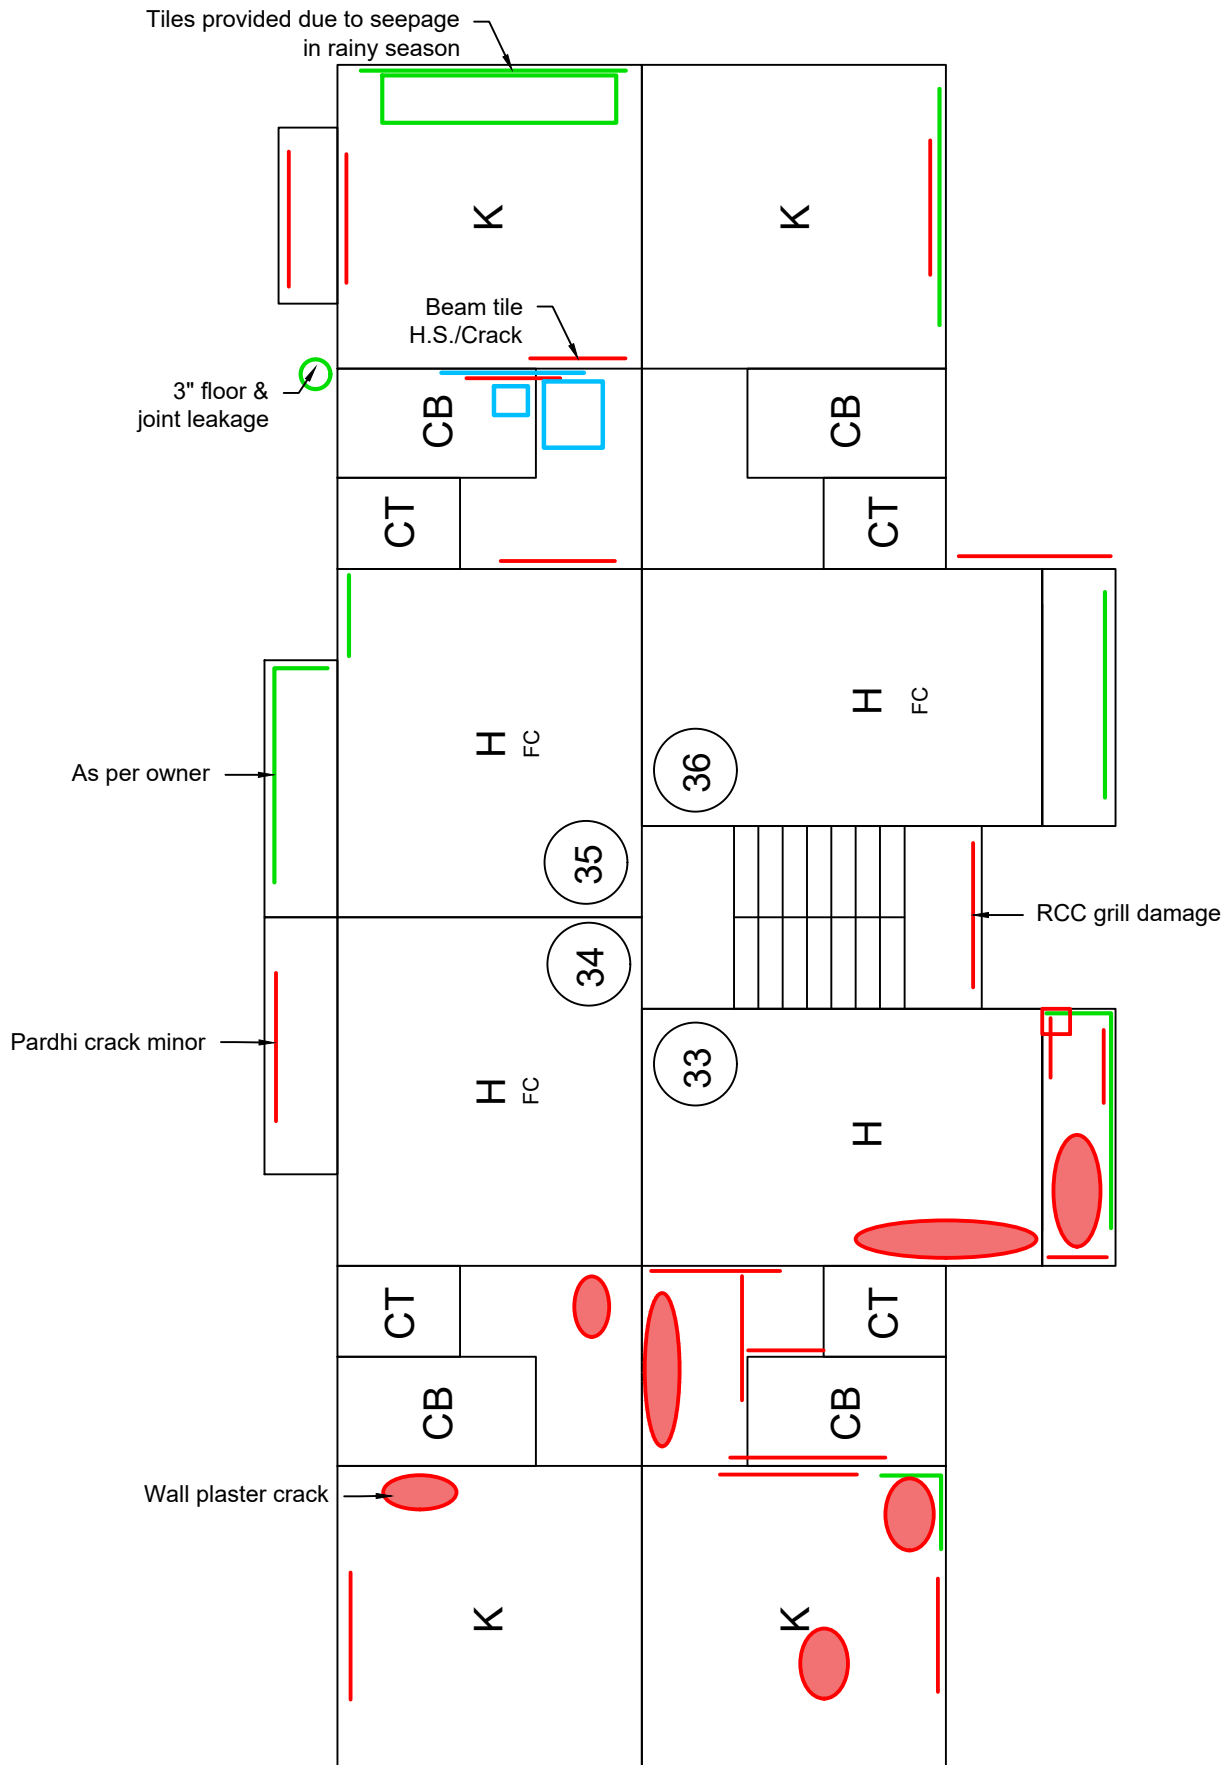


Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	

CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks

Tiles provided due to seepage in rainy season

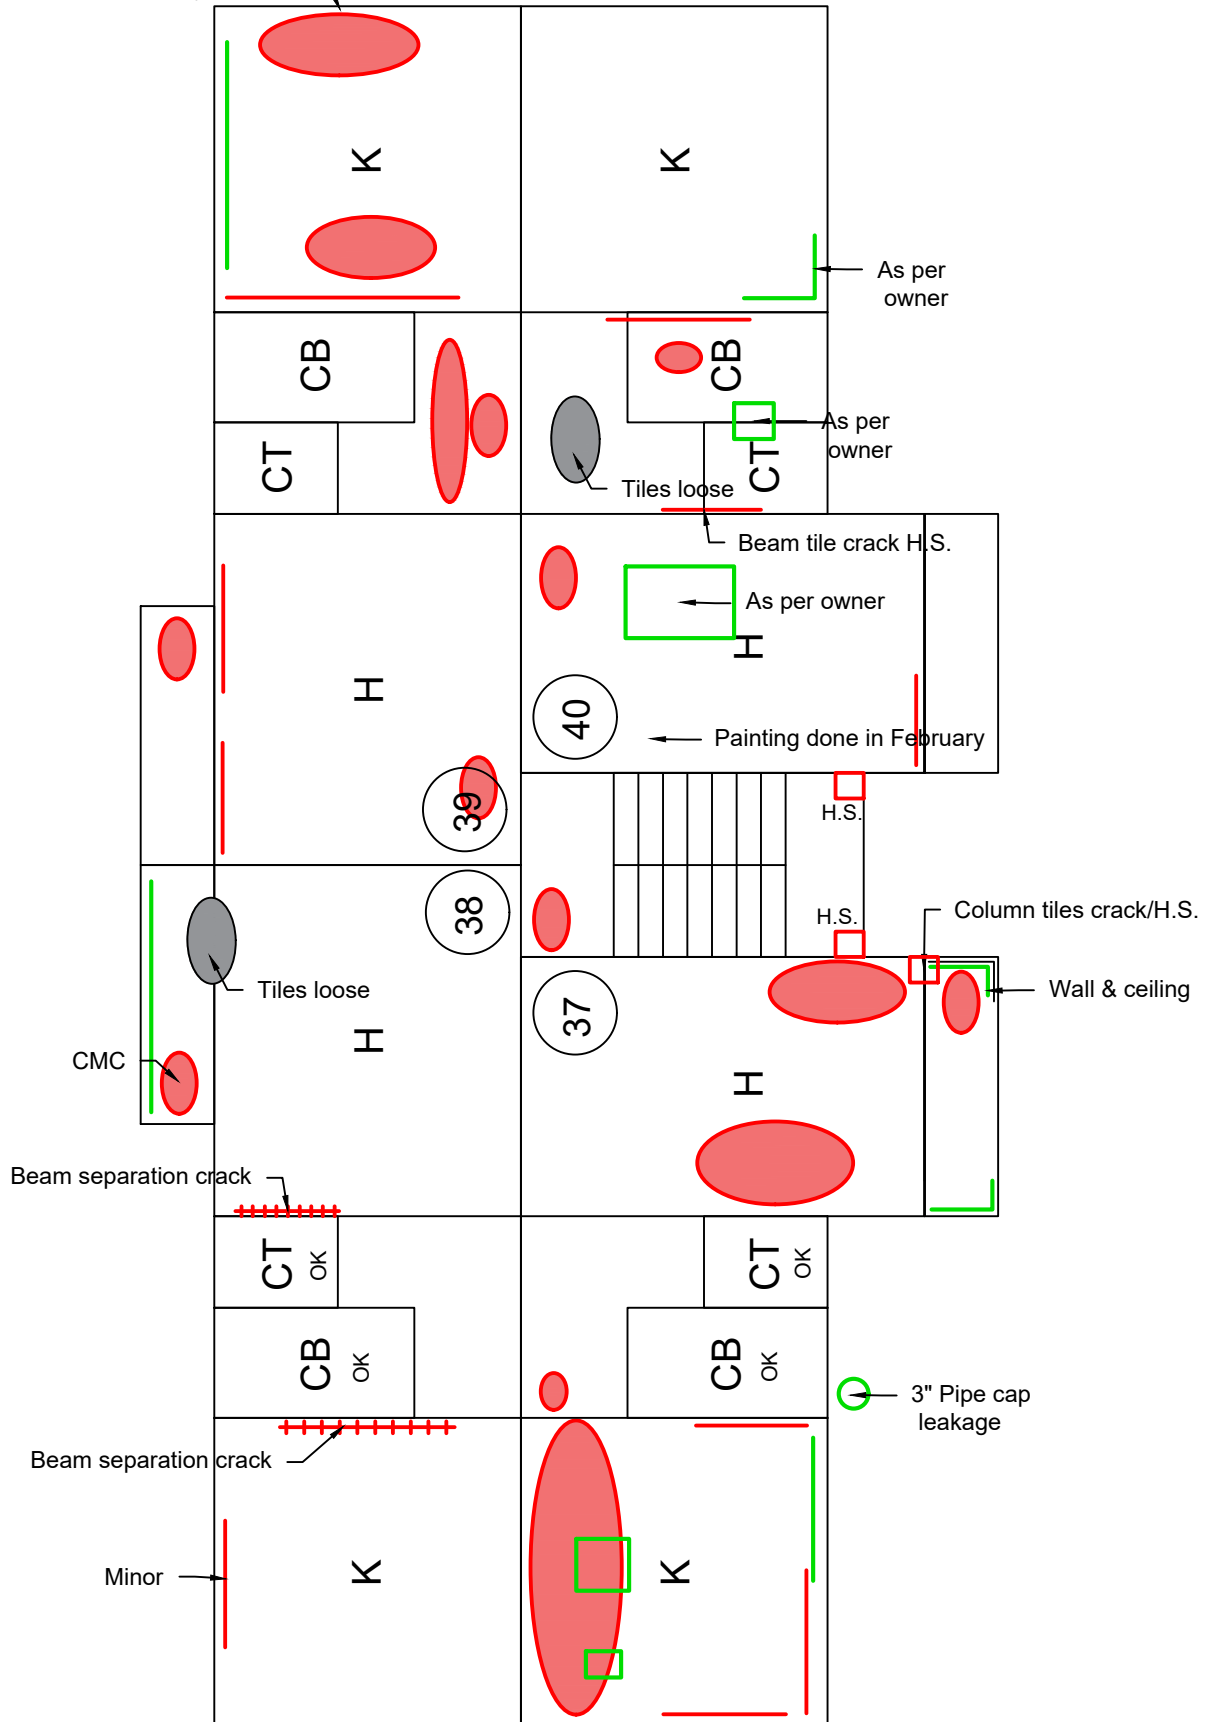

Steel framing provided ISMB/ISMC - Rusted	
Reinforcement Steel exposed	
Above Nahni Trap Ceiling area	
Side Skirting level Internal dampness	
Door Frame damaged/Rotten	

Column Structural Damages	
Beam Structural Damages	
Ceiling Structural Damages	
Floor Structural Damages	
Separation Crack	

CONSULTANT	CSR Consultant & Associates
Society Name	Rooftop CHSL, Andheri (E)
GREEN COLOR	Seepage Spots due to Exterior areas
BLUE COLOR	Seepage Spots due to Internal areas
RED COLOR	Structural Damages or severe cracks